Plinth | 2000

Bariatric Tilt Table

Models: BARI1

SERVICE MANUAL

Contents

1.	**Introduction**	**3**
	General Warnings	3
2.	**Cleaning and Decontamination**	**4**
3.	**Maintenance**	**5**
	General Maintenance	5
	Service Checklist	6
4.	**Troubleshooting**	**7**
5.	**Parts Lists and Diagrams**	**8**
	Exploded Diagram	9
	Base Drawing	10
	Lift Lever Drawing	11
	Link Lever Drawing	12
	Middle Drawing	13
	Top Drawing	14
	Footboard Drawing	15
	Patient Handle Drawing	16
6.	**Guarantee**	**17**
7.	**Technical Specification**	**18**
8.	**Revisions to Manual**	**19**

Plinth 2000 Ltd is an ISO Audited company to ISO9001:2008

Our products are CE marked in conformity with the EC Directive MDD 93/42/EEC

1. Introduction

Thank you for purchasing a product from Plinth 2000 Ltd. We use the highest quality components and manufacturing techniques to ensure that our products are simple to use and will last a long time. It is recommended that all users read and retain this User Manual for reference.

Throughout this manual notice is made of a Warning and Caution system to highlight to the user practices, procedures or conditions that should either not be allowed to happen or happen with caution.

Warnings are in a box with bold type and identify potential hazards, procedures or conditions which could result in death, injury or serious damage.

Cautions are in a box with plain type and identify conditions or procedures where if caution is not taken it may result in damage or failure of equipment.

General Warnings

WARNING

Maximum Load (SWL) is 320kg distributed evenly.

Do not use flammable gasses in proximity to an electrically operated couch.

Do not concentrate weight on either side or either end of the couch.

Use only accessories approved for use with this couch.

Disconnect power supply before moving couch.

Children must be adequately supervised in the presence of the couch.

Do not allow children to play with the couch at anytime.

2. Cleaning and Decontamination

WARNING

If contamination is suspected then decontaminate the couch before use.

Torn or damaged upholstery should be replaced immediately.

CAUTION

Do not use Alkalis or other organic solvents for routine cleaning.

Always cover the vinyl with paper towelling or couch covers if it can come into contact with bare skin.

Cleaning

Always wear suitable protective clothing before carrying out this procedure. Disconnect the mains supply to the couch and move it to a suitable cleaning area and lock the castors.

Step 1. Using warm water and soap on a damp cloth, carefully wipe the couch over from top to bottom. Take great care around electrical components.

Step 2. Wipe the couch carefully from top to bottom using a clean damp cloth and soap free water.

Step 3. Carefully dry the couch from top to bottom with clean lint free paper towels.

Decontamination

To decontaminate the couch repeat the above steps but using a dilute solution of Hypochlorite and warm water (10,000ppm) instead of warm water and soap. At the end of the procedure discard all cleaning materials in a safe manner and wash hands thoroughly.

3. Maintenance

Plinth 2000 Ltd products are designed to be maintenance free. However keeping your Plinth products clean and regularly checked will assist in prolonging their working life. The following is a guide of simple checks that the user can carry out on a six monthly basis. We would also recommend an annual service visit by a Plinth 2000 trained engineer.

WARNING

Disconnect couch from electrical supply before commencing any of the following checks.

Examine the couch for any signs of damage. Pay particular attention to all nuts, bolts and fasteners to check they are present and tight but not over tight.

Upholstery bolts should all be checked (each section has between 2 and 6 No. M6 bolts), they should all be present and tight.

Check gas struts (if fitted) and ensure that they operate through the full range of movement and lock fully.

Check hinge pins are lubricated.

Check main couch nylon pivot bearings are lubricated sufficiently.

Examine mains and switch cables for any damage, cuts, kinks, abrasions etc. These must be replaced if necessary.

Check mains lead, switch cables and slave motor leads are all correctly and securely attached.

Check correct plug fuse is fitted (5A).

WARNING

Any electrical checks or work other than the visual inspection above must be performed by a qualified electrician.

Do not connect BLUE or BROWN wires to the earth terminal of a plug.

Plinth | 2000

Service Check Sheet

Plinth 2000 Ltd.
Wetheringsett Manor
Wetheringsett
Stowmarket
Suffolk IP14 5PP
United Kingdom

t: +44 (0)1449 767887
f: +44 (0)1449 766122
e: sales@plinth2000.com

www.plinth2000.com

- ☐ CORRECT COUCH TO BE SERVICED
- ☐ IDENTIFY SERIAL NUMBER
- ☐ IDENTIFY PUMP/MOTOR TYPE
- ☐ ANY SPECIFIC FAULTS ADVISED BY CUSTOMER
- ☐ CAPS & FERRULES ETC
- ☐ ADJUSTABLE FOOT & FOOTCAPS
- ☐ UPHOLSTERY CONDITION
- ☐ NUTS, BOLTS & FASTENINGS TIGHT & GOOD CONDITION
- ☐ GAS STRUTS (if applicable)
- ☐ BACKREST & FOOTREST SPRINGS (if applicable)
- ☐ BACKREST & FOOTREST OPERATION (sections hold with no slip)
- ☐ PEDAL RUBBERS
- ☐ STARLOCKS TIGHT & GOOD CONDITION
- ☐ NYLON BUSHES (Y/N)
- ☐ IF NO CHECK FRAME FREE AND NOT AT RISK OF SEIZING
- ☐ OIL WHEEL PEDAL SYSTEM
- ☐ OIL HINGES
- ☐ OIL FRAME BEARING POINTS
- ☐ OIL PUMP/MOTOR FITTING POINTS
- ☐ FRAME CHECK (welds & overall condition)
- ☐ MAINS CABLE & PLUG CONDITION (if applicable)
- ☐ HAND/FOOT SWITCH CONDITION (if applicable)
- ☐ FUNCTION TEST OF PUMP/MOTOR
- ☐ AGE AND LIFE OF MOTOR IF KNOWN (use manufacturers guideline chart)
- ☐ WEIGHT TEST
- ☐ SERVICE STICKER FITTED

4. Troubleshooting

In the unlikely event of the couch failing to operate and having carried out the normal practical fault finding steps below then please contact our Customer Service Team on +44 (0)1449 767887 or email customerservice@plinth2000.com. **Please have the serial number to hand before making contact so we can help you more efficiently.**

Fault	Possible Cause	Remedy
Couch is unstable	Uneven floor Damaged Castor	Move couch to flat floor Replace Castor
All motors will not work	Power disconnected Fuse Blown Hand/ Footswitch disconnected	Connect power supply Replace fuse in plug Check the switch is fully connected to the motor
One motor will not work but other working	Lead from height motor/control box not connected to slave motor Fault with switch Fault with control box Fault with motor	Check and connect all leads Replace switch Replace control box Replace motor
Motor sinks	Switch permanently operated Motor fault	Unplug and re-connect switch Replace motor
Patient Grab Handles don't lock	Thread in locking lever stripped Thread in Grab Handles stripped	Replace locking lever(s) Replace Grab Handles

5. Parts Lists and Diagrams

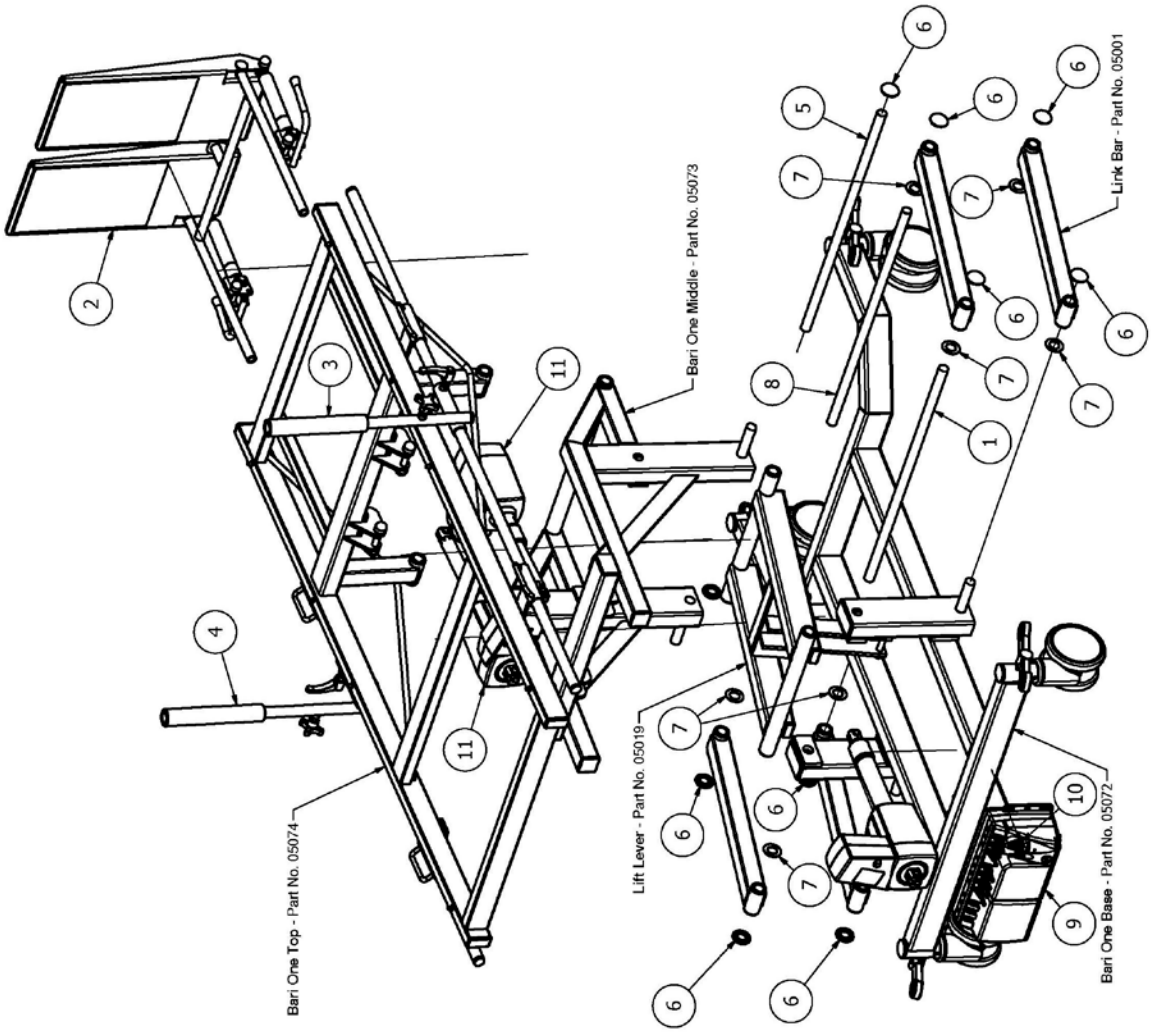

PARTS LIST		
ITEM	QTY	PART NUMBER
1	1	20mm Bright Round - 610mm - Part No. 01155
2	1	Part No. 05175 - Tilt Foot Board Assembly
3	1	Part No. 05209A - Bari Grab Handle
4	1	Part No. 05209B - Bari Grab Handle
5	1	20mm Bright Round - 625mm - Part No. 01163
6	10	20mm Dome Cap Star Lock - Part No. #0116
7	8	Form B 20mm Washer - Part No. #0146
8	1	20mm Bright Round - 615mm - Part No. 01162
9	1	CB20
10	2	3/4 Phillips Screw - Part No. #0191
11	3	Linak LA34 - 200mm Stroke

Bari One Base - Part No. 05072

PARTS LIST		
ITEM	QTY	PART NUMBER
1	4	M8 @ 25mm - Part No. #0157
2	2	Brake Lever
3	7	M12 Form B Washer - Part No. #0145
4	2	Part No. 05207 - Bari Tilt Hex Fitting
5	4	38 Tube Bung - Part No. #0121
6	2	80x40 RHS Cap Thin - With Cut Out - Part No. #0131
7	1	11mm Hex Bar @ 890mm - Part No. 01228
8	2	Brake Lever - Part No. #0138A1
9	4	Brake Lever Green Insert - Part No. #0245
10	4	Brake Lever Red Insert - Part No. #0244
11	4	Steinco Hex Large Castor - Part No. #0264

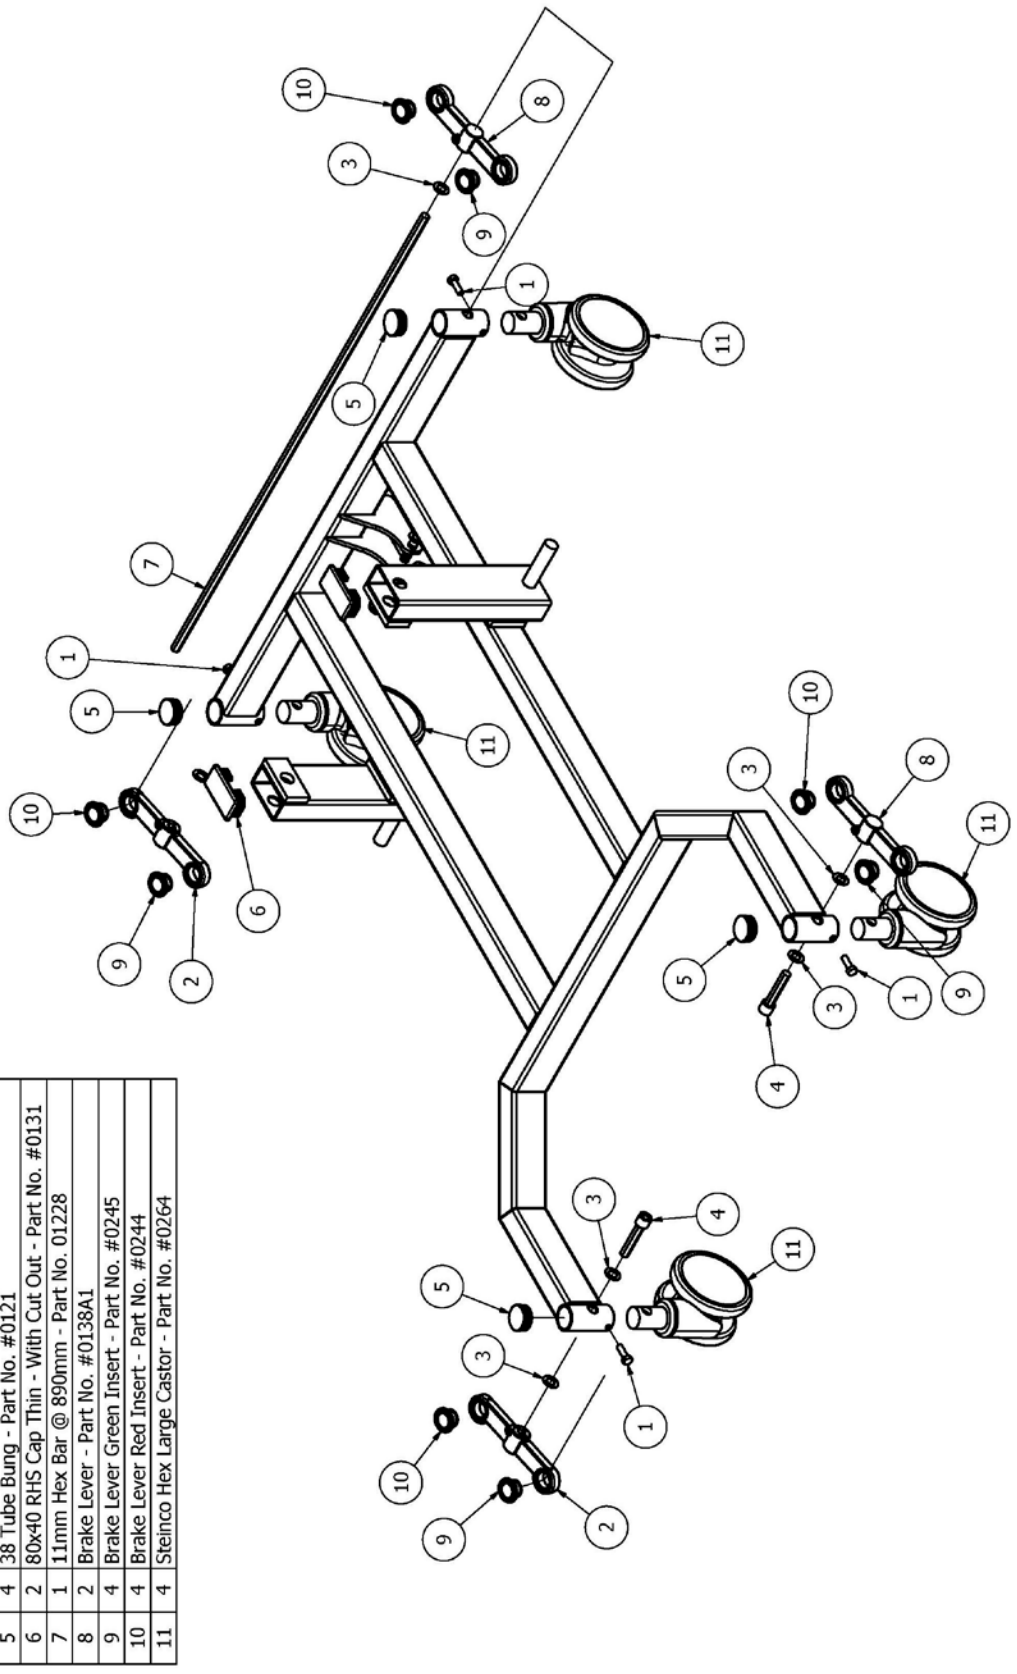

L50 Lift Lever - Part No. 05019

PARTS LIST		
ITEM	QTY	PART NUMBER
1	4	20mm Nylon Bush - Part No. #0182
2	4	40x20 Cap - Part No. #0122
3	1	M12 Form B Washer #0145 - M12 @ 75mm Bolt #0176 - M12 Dome Cap #0177
4	1	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177

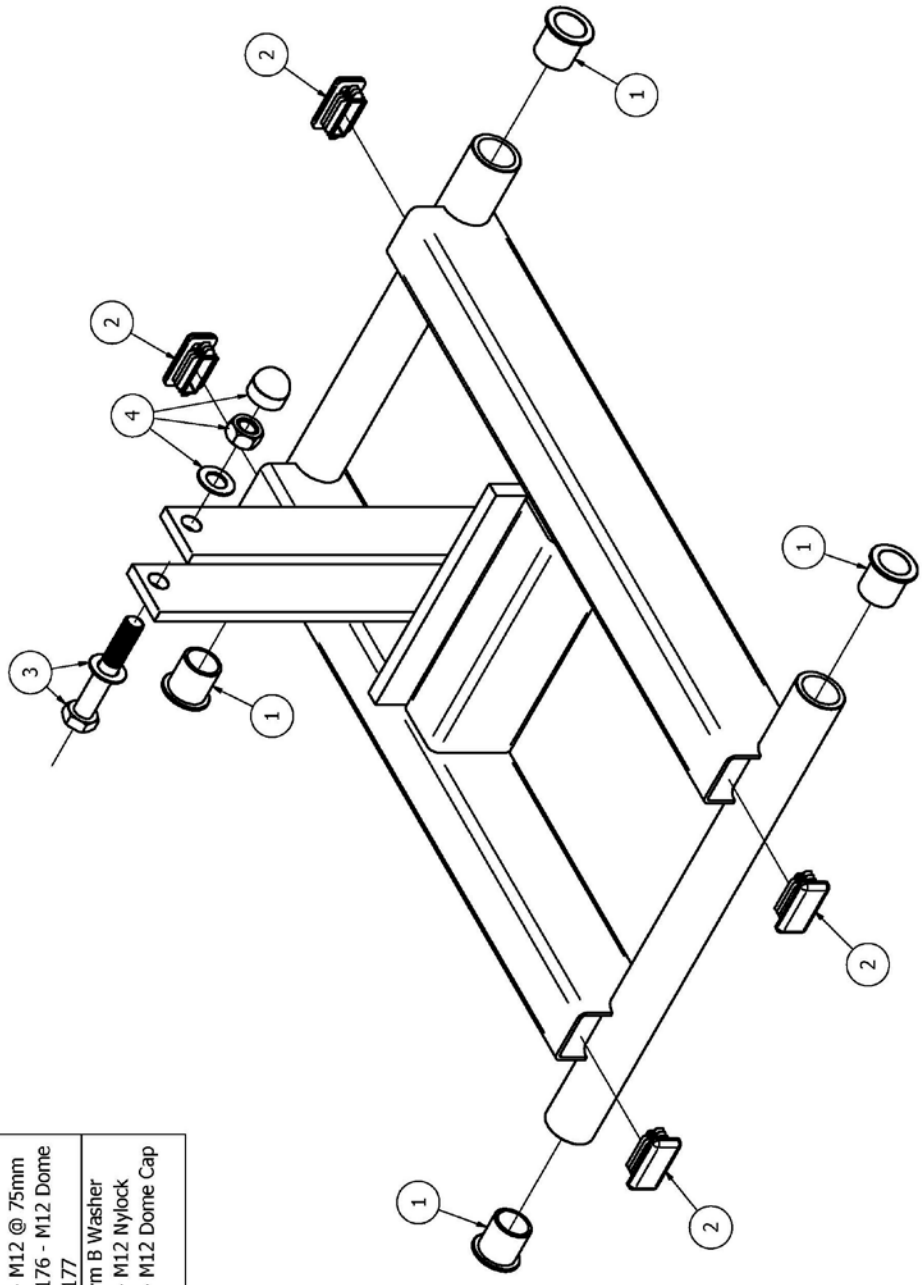

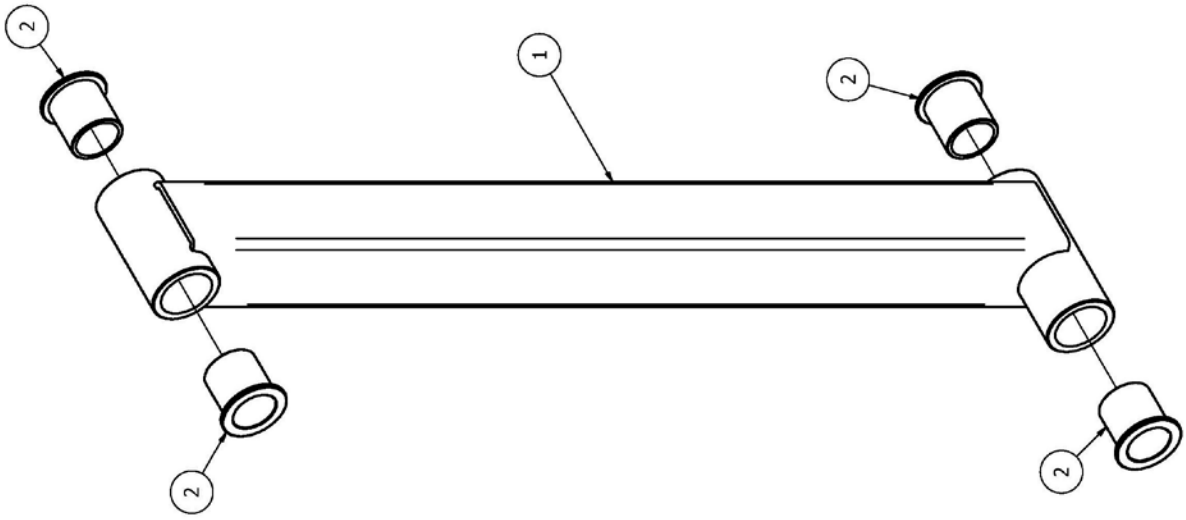

Link Bar - Part No. 05001

PARTS LIST		
ITEM	QTY	PART NUMBER
1	1	Std. 60-80 Link Bar - Part No. 05002
2	4	20mm Nylon Bush - Part No. #0182

Bari One Middle - Part No. 05073

PARTS LIST		
ITEM	QTY	PART NUMBER
1	2	20mm Nylon Bush - Part No. #0182
2	2	40x40 Cap - Part No. #0123
3	2	60x40 Cap - Part No. #0127
4	2	M12 Form B Washer #0145 - M12 Bolt @ 60mm #0175 - M12 Dome Cap #0177
5	2	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177

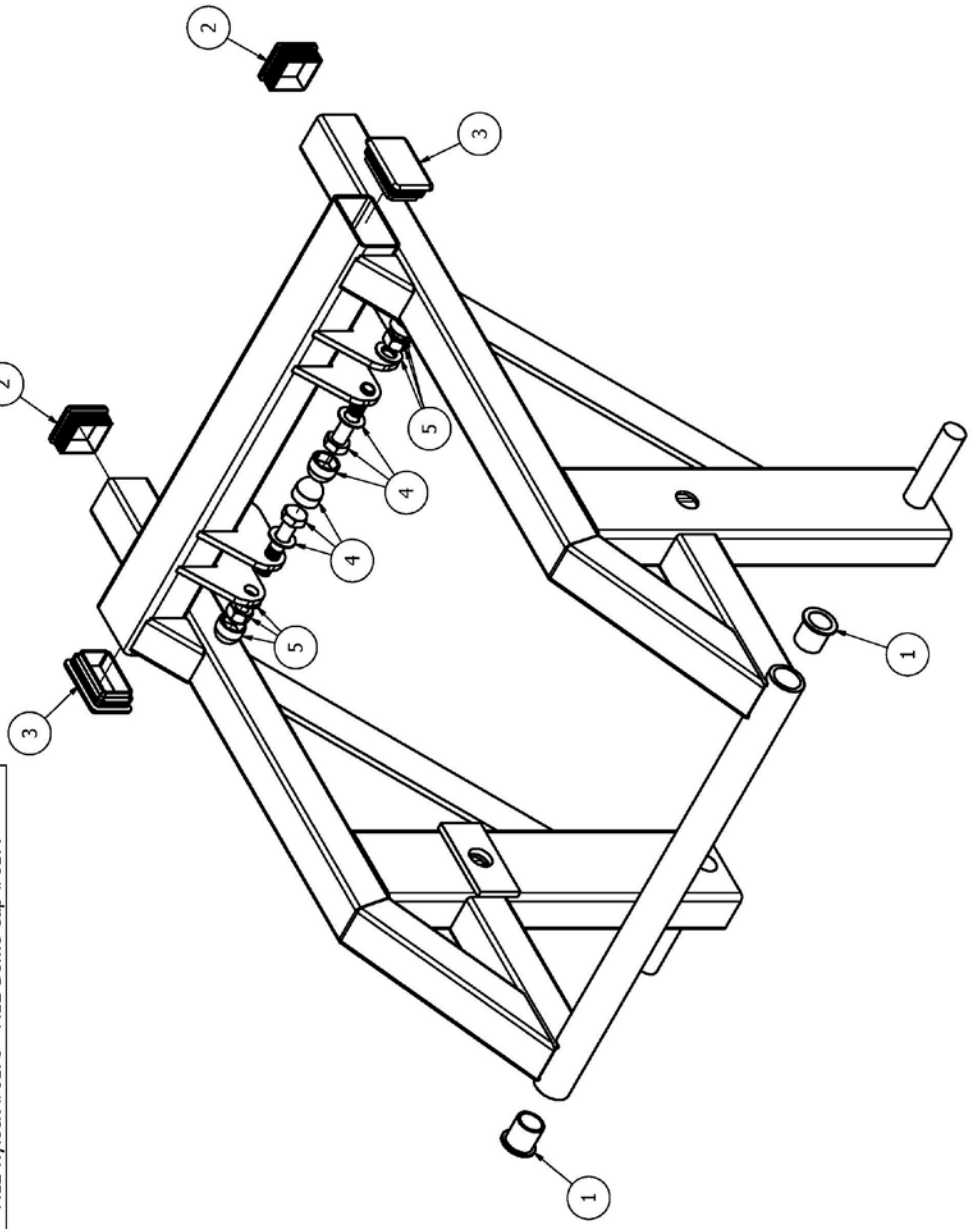

Bari One Top - Part No. 05074

PARTS LIST		
ITEM	QTY	PART NUMBER
1	4	20mm Nylon Bush - Part No. #0182
2	4	Part No. 05208 - Bari & Tilt Side Fittings
3	2	1450mm Grab Rail - Part No. #0197
4	4	22.22x3 Tube Bung - Part No. #0117
5	2	M8 Star Handwheel - Male - Part No. #0162
6	2	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177
7	2	M12 Form B Washer #0145 - M12 Bolt @ 60mm #0175 - M12 Dome Cap #0177
8	4	50x25 Cap - Part No. #0126
9	6	M6 @ 60mm + Repair Washer

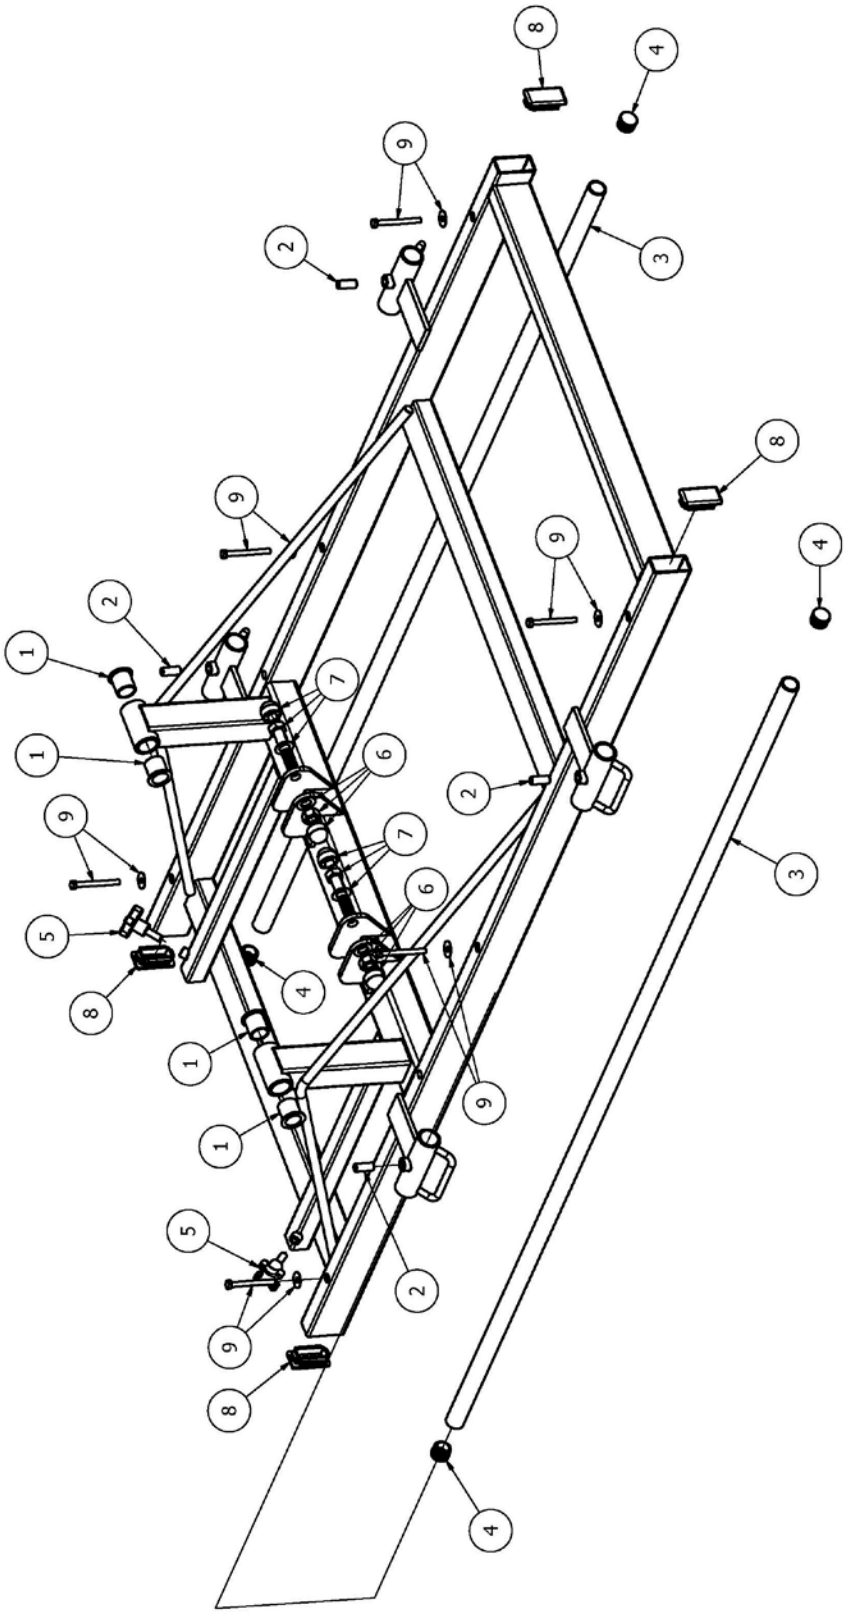

Tilting Divided Foot Board Assembly

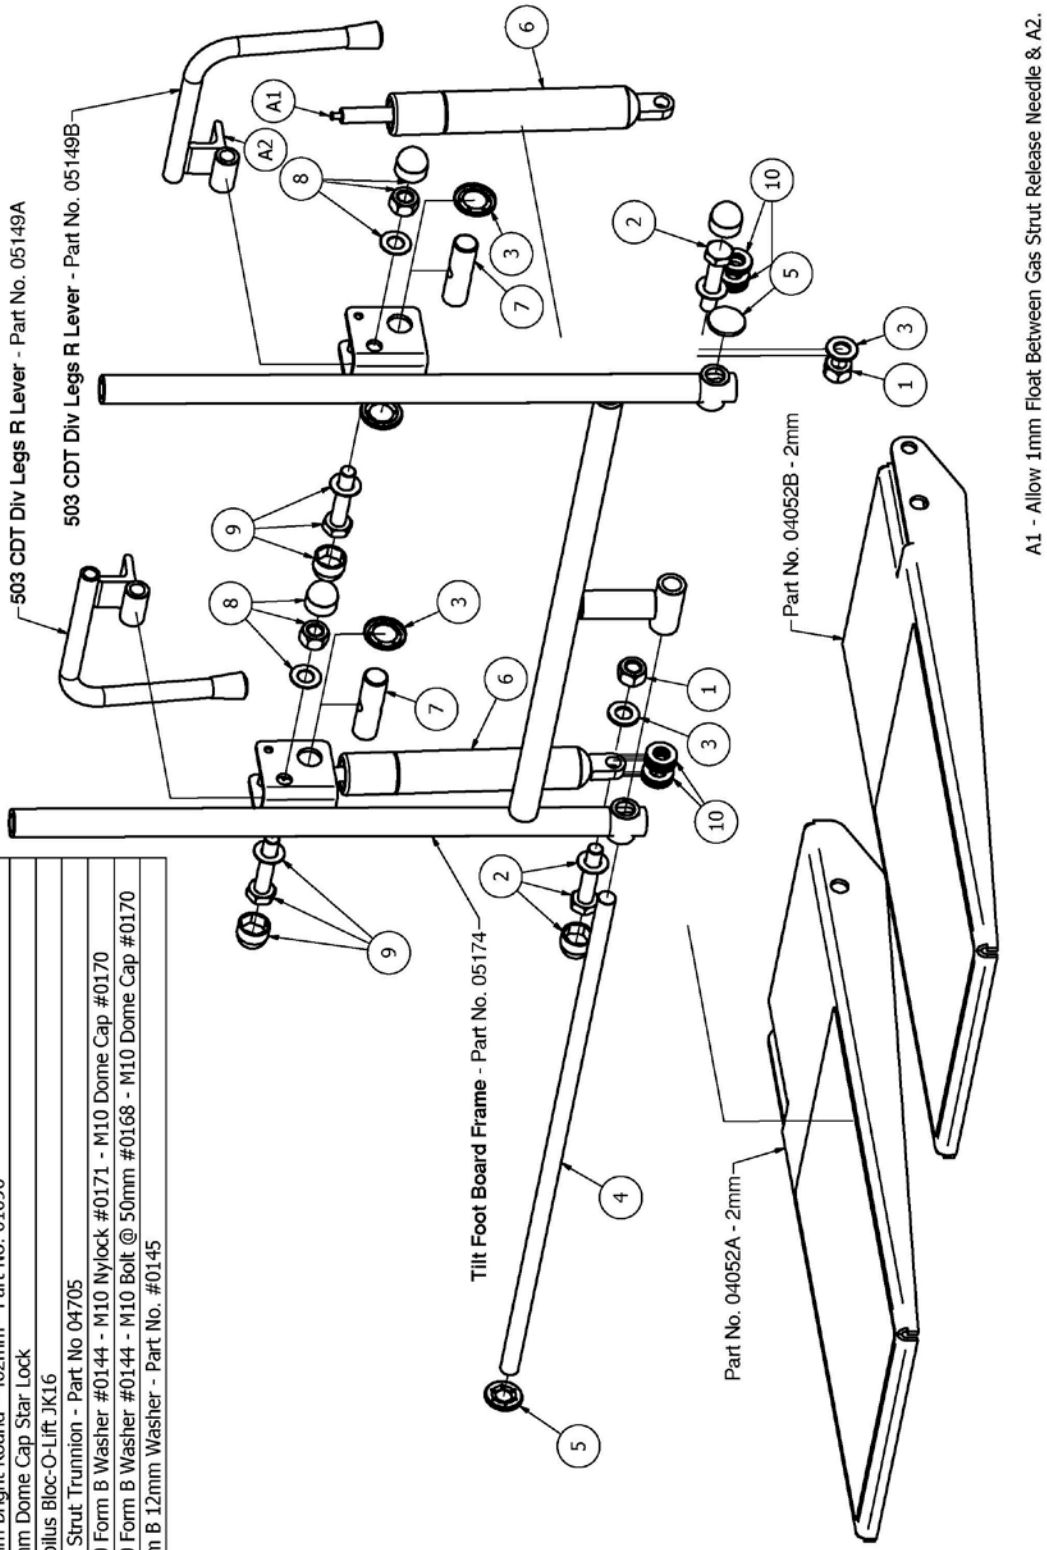

PARTS LIST		
ITEM	QTY	PART NUMBER
1	2	M10 Nylock
2	2	M10 Form B Washer #0144 - M10 Bolt @ 50mm #0168 - M10 Dome Cap #0170
3	2	Form B 10mm Washer #0144
4	1	12mm Bright Round - 462mm - Part No. 01090
5	2	12mm Dome Cap Star Lock
6	2	Stabilus Bloc-O-Lift JK16
7	2	Gas Strut Trunnion - Part No 04705
8	2	M10 Form B Washer #0144 - M10 Nylock #0171 - M10 Dome Cap #0170
9	2	M10 Form B Washer #0144 - M10 Bolt @ 50mm #0168 - M10 Dome Cap #0170
10	12	Form B 12mm Washer - Part No. #0145

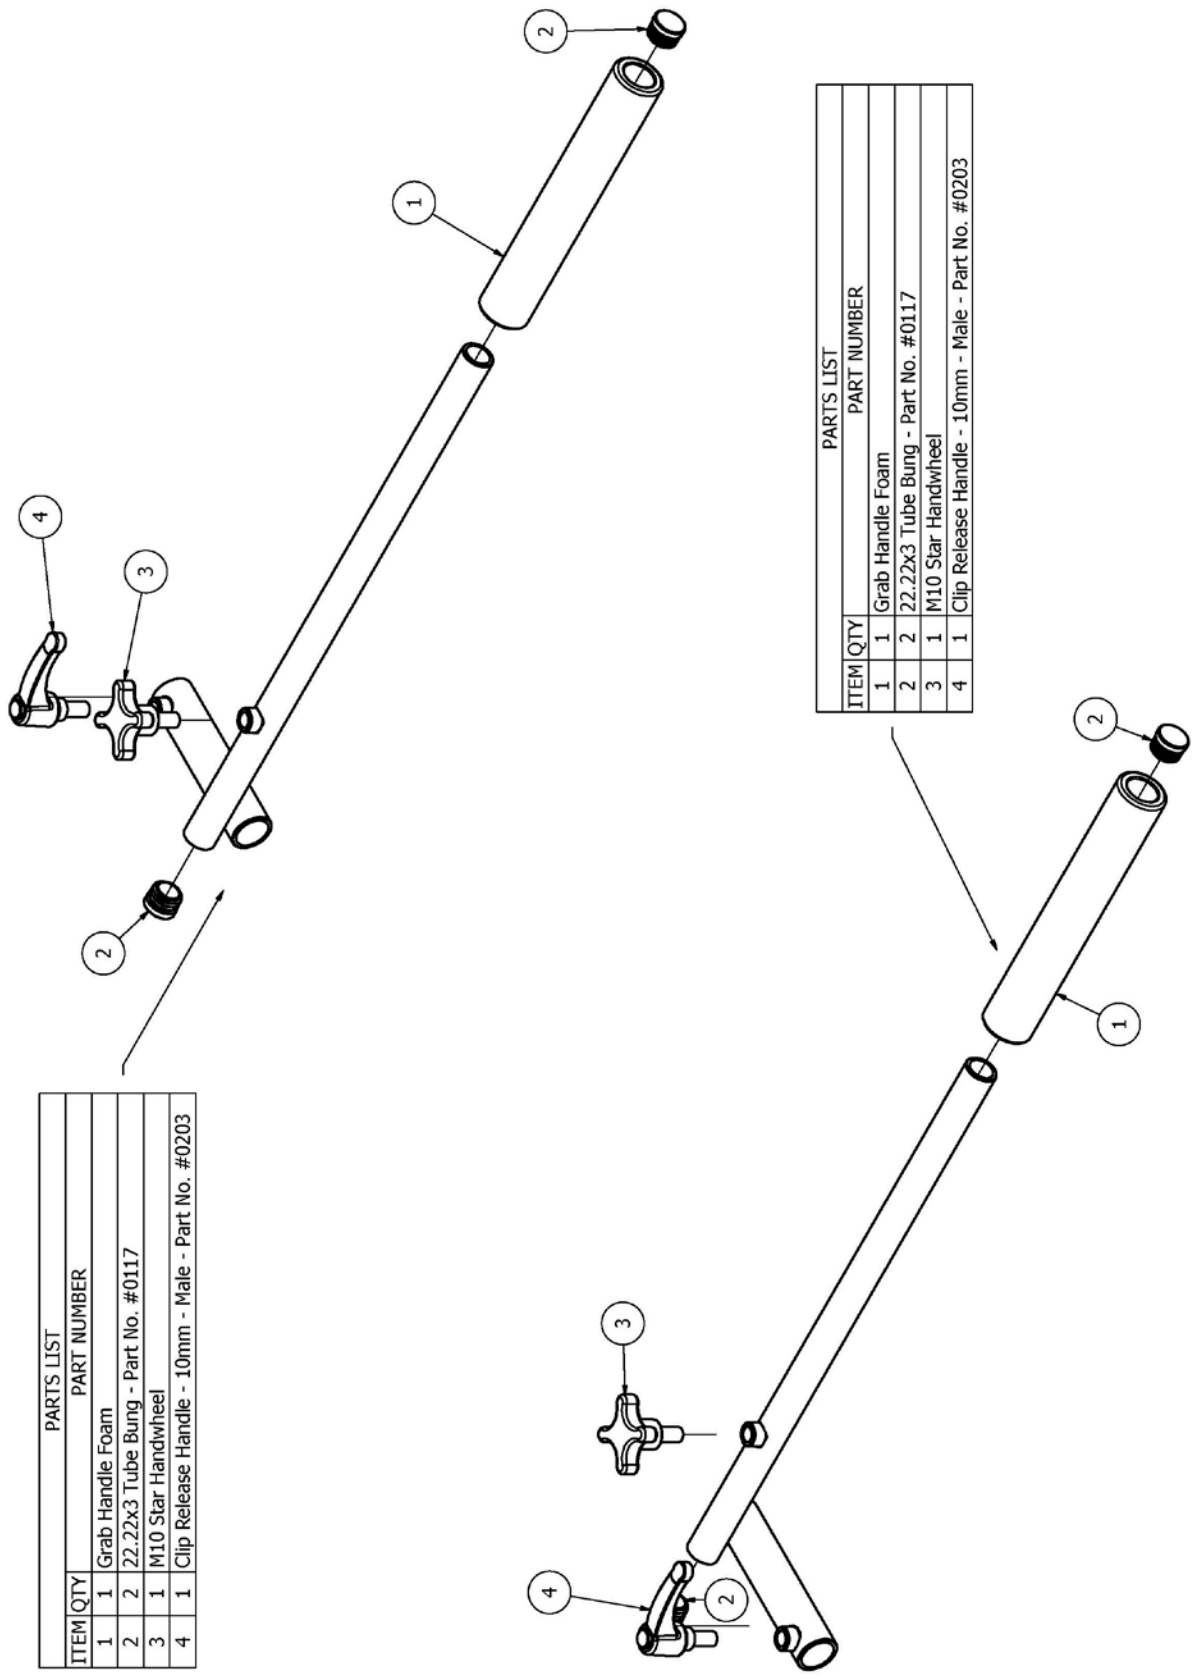
PARTS LIST
ITEM QTY PART NUMBER
1 1 Grab Handle Foam
2 2 22.22x3 Tube Bung - Part No. #0117
3 1 M10 Star Handwheel
4 1 Clip Release Handle - 10mm - Male - Part No. #0203
PARTS LIST
ITEM QTY PART NUMBER
1 1 Grab Handle Foam
2 2 22.22x3 Tube Bung - Part No. #0117
3 1 M10 Star Handwheel
4 1 Clip Release Handle - 10mm - Male - Part No. #0203

6. Guarantee and Service (UK only)

Plinth 2000 Ltd offer a 5 year parts guarantee on all BARI Range products delivered from January 2013 and a lifetime frame guarantee. The only exclusion to this guarantee is for negligent damage or damage to upholstery coverings. This guarantee does not require registration of the product as we can trace it from its serial number, however in the event of the serial number being removed, missing or unreadable then this may void the guarantee. These terms do not affect your statutory rights.

In addition to the above Plinth 2000 Ltd can offer both extended warranties and service contracts. For further information about either of these please contact:

Customer Service
Plinth 2000 Ltd
Wetheringsett Manor
Wetheringsett
Stowmarket
Suffolk
IP14 5PP
Tel: 01449 767887
Mail: customerservice@plinth2000.com

In the event of returning a product or part to us then please follow the instructions for cleaning under section 5 before enclosing it in suitable packaging and returning it to the above address. In addition please ensure there is a statement confirming that it has been decontaminated and what the fault is along with relevant contact details.

Worldwide

Please contact the distributor you purchased the couch from for service and support in your country. If you are unable to do so then please contact us in the UK and we will refer you to our local representative.

7. Technical Specifications

	BARI1			
Top Length (cm)	**185**			
Top Width (cm)	**78**			
Overall Width (cm)	**80**			
Overall Length (cm)	**185**			
Height Range (cm)	**48-97**			
Max Working Load	**320kg**			
Control	**Hand Switch**			
Electrical Data 220/240v				
Motor(s)	**Linak LA34 x 3**			
Control Box	**Linak CB20**			
Current	**1.5A**			
Power	**360W**			
Mains Plug Fuse	**5.0A x 1**			
Internal Fuse	**1.5A x 1**			
System Voltage	**24v**			
IP Rating	**IPX4**			
Electrical Data 110/120v				
Motor(s)	**Linak LA34 x 3**			
Control Box	**Linak CB20**			
Current	**1.5A**			
Power	**360W**			
Mains Plug Fuse	**5.0A x 1**			
Internal Fuse	**1.5A x 1**			
System Voltage	**24v**			
IP Rating	**IPX4**			

IEC 601-1 Electrical Safety Classification

All electric models are double insulated Type B equipment and marked as such.

Double Insulated

Type B Equipment

8. Revisions to Manual

Pages	Issue No	Name	Date
All	Manual - 01	Niall Dyer	15.10.12
All	Manual - 02	Niall Dyer	07.01.14

Plinth 2000 Ltd
Wetheringsett Manor
Wetheringsett
Stowmarket
Suffolk
IP14 5PP
ENGLAND

Plinth 2000 Ltd is an ISO Audited company to ISO9001:2008

Our products are CE marked in conformity with the EC Directive MDD 93/42/EEC