Plinth | 2000

Bariatric Trolley

Model: BARI3

SERVICE MANUAL

Contents

1.	**Introduction**	**3**
	General Warnings	3
2.	**Cleaning and Decontamination**	**4**
3.	**Maintenance**	**5**
	General Maintenance	5
	Service Checklist	6
4.	**Troubleshooting**	**7**
5.	**Parts List and Diagrams**	**8**
	Exploded Diagram	9
	Base Drawing	10
	Lift Lever Drawing	11
	Link Lever Drawing	12
	Middle Drawing	13
	Top Drawing	14
	Back-Rest Drawing	15
	Leg-Rest Drawing	16
	Foot Board Drawing	17
	Cot Side Rail Drawing	18
	Arm/Side Support Drawing	19
6.	**Guarantee and Service**	**20**
7.	**Technical Specification**	**21**
8.	**Revisions to Manual**	**22**

Plinth 2000 Ltd is an ISO Audited company to ISO9001:2008

Our products are CE marked in conformity with the EC Directive MDD 93/42/EEC

1. Introduction

Thank you for purchasing a product from Plinth 2000 Ltd. We use the highest quality components and manufacturing techniques to ensure that our products are simple to use and will last a long time. It is recommended that all users read and retain this User Manual for reference.

Throughout this manual notice is made of a Warning and Caution system to highlight to the user practices, procedures or conditions that should either not be allowed to happen or happen with caution.

Warnings are in a box with bold type and identify potential hazards, procedures or conditions which could result in death, injury or serious damage.

Cautions are in a box with plain type and identify conditions or procedures where if caution is not taken it may result in damage or failure of equipment.

General Warnings

WARNING

Maximum Load (SWL) is 320kg distributed evenly.

Do not use flammable gasses in proximity to an electrically operated trolley.

Do not concentrate weight on either side or either end of the trolley.

Use only accessories approved for use with this trolley.

Children must be adequately supervised in the presence of the trolley.

Do not allow children to play with the trolley at any time.

2. Cleaning and Decontamination

WARNING

If contamination is suspected then decontaminate the trolley before use.

Torn or damaged upholstery should be replaced immediately.

CAUTION

Do not use Alkalis or other organic solvents for routine cleaning.

Always cover the vinyl with paper towelling or trolley covers if it can come into contact with bare skin.

Cleaning

Always wear suitable protective clothing before carrying out this procedure. Disconnect the mains supply to the trolley and move it to a suitable cleaning area and lock the castors.

Step 1. Using warm water and soap on a damp cloth, carefully wipe the trolley over from top to bottom. Take great care around electrical components.

Step 2. Wipe the trolley carefully from top to bottom using a clean damp cloth and soap free water.

Step 3. Carefully dry the trolley from top to bottom with clean lint free paper towels.

Decontamination

To decontaminate the trolley repeat the above steps but using a dilute solution of Hypochlorite and warm water (10,000ppm) instead of warm water and soap. At the end of the procedure discard all cleaning materials in a safe manner and wash hands thoroughly.

3. Maintenance

Plinth 2000 Ltd products are designed to be maintenance free. However keeping your Plinth products clean and regularly checked will assist in prolonging their working life. The following is a guide of simple checks that the user can carry out on a six monthly basis. We would also recommend an annual service visit by a Plinth 2000 trained engineer.

WARNING

Disconnect trolley from electrical supply before commencing any of the following checks.

Examine the trolley for any signs of damage. Pay particular attention to all nuts, bolts and fasteners to check they are present and tight but not over tight.

Upholstery bolts should all be checked (each section has between 2 and 6 No. M6 bolts), they should all be present and tight.

Check gas struts (if fitted) and ensure that they operate through the full range of movement and lock fully.

Check hinge pins are lubricated and not rusty.

Check main trolley nylon pivot bearings are lubricated sufficiently.

Examine mains and switch cables for any damage, cuts, kinks, abrasions etc. These must be replaced if necessary.

Check mains lead, switch cables and slave motor leads are all correctly and securely attached.

Check correct plug fuse is fitted (5A).

WARNING

Any electrical checks or work other than the visual inspection above must be performed by a qualified electrician.

Do not connect BLUE or BROWN wires to the earth terminal of a plug.

Plinth | 2000

Service Check Sheet

Plinth 2000 Ltd.
Wetheringsett Manor
Wetheringsett
Stowmarket
Suffolk IP14 5PP
United Kingdom

t: +44 (0)1449 767887
f: +44 (0)1449 766122
e: sales@plinth2000.com

www.plinth2000.com

- ☐ CORRECT COUCH TO BE SERVICED
- ☐ IDENTIFY SERIAL NUMBER
- ☐ IDENTIFY PUMP/MOTOR TYPE
- ☐ ANY SPECIFIC FAULTS ADVISED BY CUSTOMER
- ☐ CAPS & FERRULES ETC
- ☐ ADJUSTABLE FOOT & FOOTCAPS
- ☐ UPHOLSTERY CONDITION
- ☐ NUTS, BOLTS & FASTENINGS TIGHT & GOOD CONDITION
- ☐ GAS STRUTS (if applicable)
- ☐ BACKREST & FOOTREST SPRINGS (if applicable)
- ☐ BACKREST & FOOTREST OPERATION (sections hold with no slip)
- ☐ PEDAL RUBBERS
- ☐ STARLOCKS TIGHT & GOOD CONDITION
- ☐ NYLON BUSHES (Y/N)
- ☐ IF NO CHECK FRAME FREE AND NOT AT RISK OF SEIZING
- ☐ OIL WHEEL PEDAL SYSTEM
- ☐ OIL HINGES
- ☐ OIL FRAME BEARING POINTS
- ☐ OIL PUMP/MOTOR FITTING POINTS
- ☐ FRAME CHECK (welds & overall condition)
- ☐ MAINS CABLE & PLUG CONDITION (if applicable)
- ☐ HAND/FOOT SWITCH CONDITION (if applicable)
- ☐ FUNCTION TEST OF PUMP/MOTOR
- ☐ AGE AND LIFE OF MOTOR IF KNOWN (use manufacturers guideline chart)
- ☐ WEIGHT TEST
- ☐ SERVICE STICKER FITTED

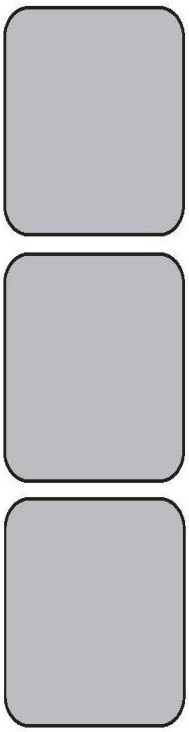

4. Troubleshooting

In the unlikely event of the trolley failing to operate and having carried out the normal practical fault finding steps below then please contact our Customer Service Team on +44 (0)1449 767887 or email customerservice@plinth2000.com. **Please have the serial number to hand before making contact so we can help you more efficiently.**

Fault	Possible Cause	Remedy
Trolley is unstable	Uneven floor Damaged Castor	Move trolley to flat floor Check presence and condition of all castors
All motors will not work	Power disconnected Hand/ Footswitch disconnected	Connect power supply Check the switch is fully connected to the motor
One motor will not work but other is working	Lead from height motor/control box not connected to slave motor Fault with switch Fault with control box Fault with motor	Check and connect all leads Replace switch Replace control box Replace motor
Motor sinks	Switch permanently operated Motor fault	Unplug and re-connect switch Replace motor
Backrest will not work	See one motor will not work section above	See one motor will not work section above
Leg rest sinks under load	Gas spring adjustment Gas spring fault	Adjust Gas spring Replace Gas spring
Armrests slip or are loose	Locking thumbwheels not correctly tightened Thumbwheels damaged from over tightening	Correctly tighten locking thumbwheels Replace thumbwheels

5. Parts List and Diagrams

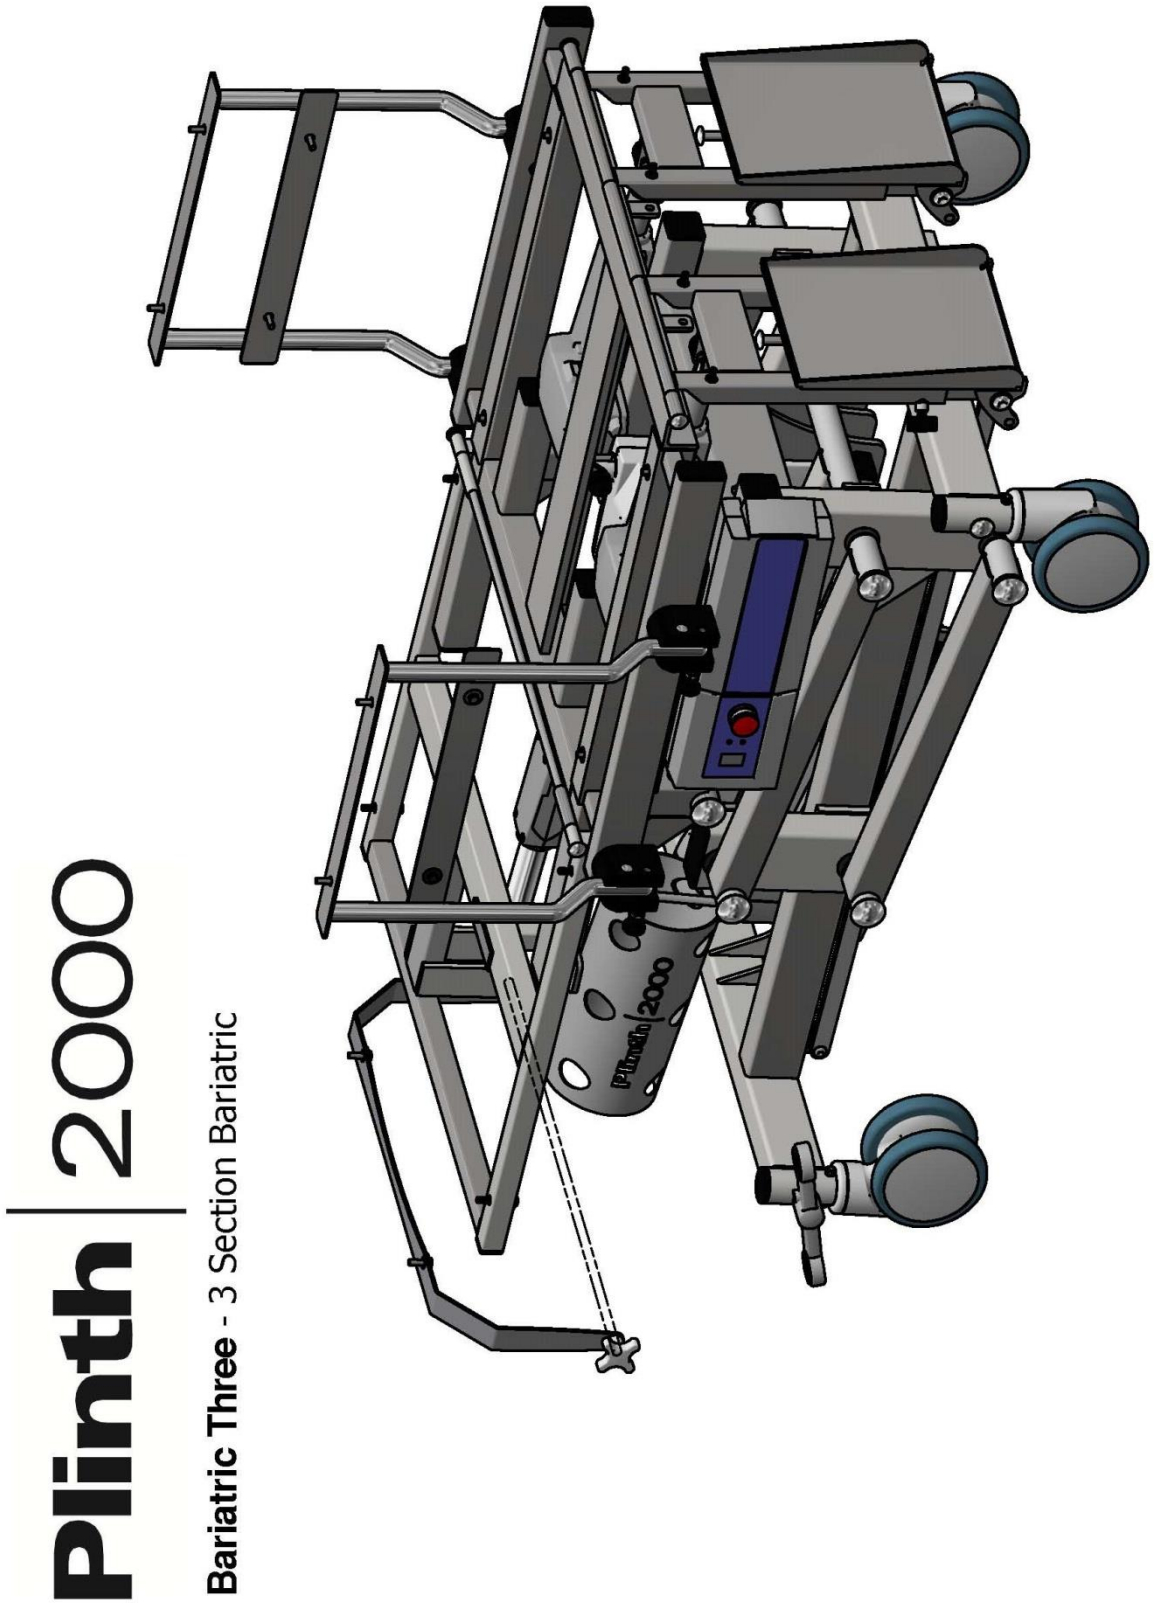

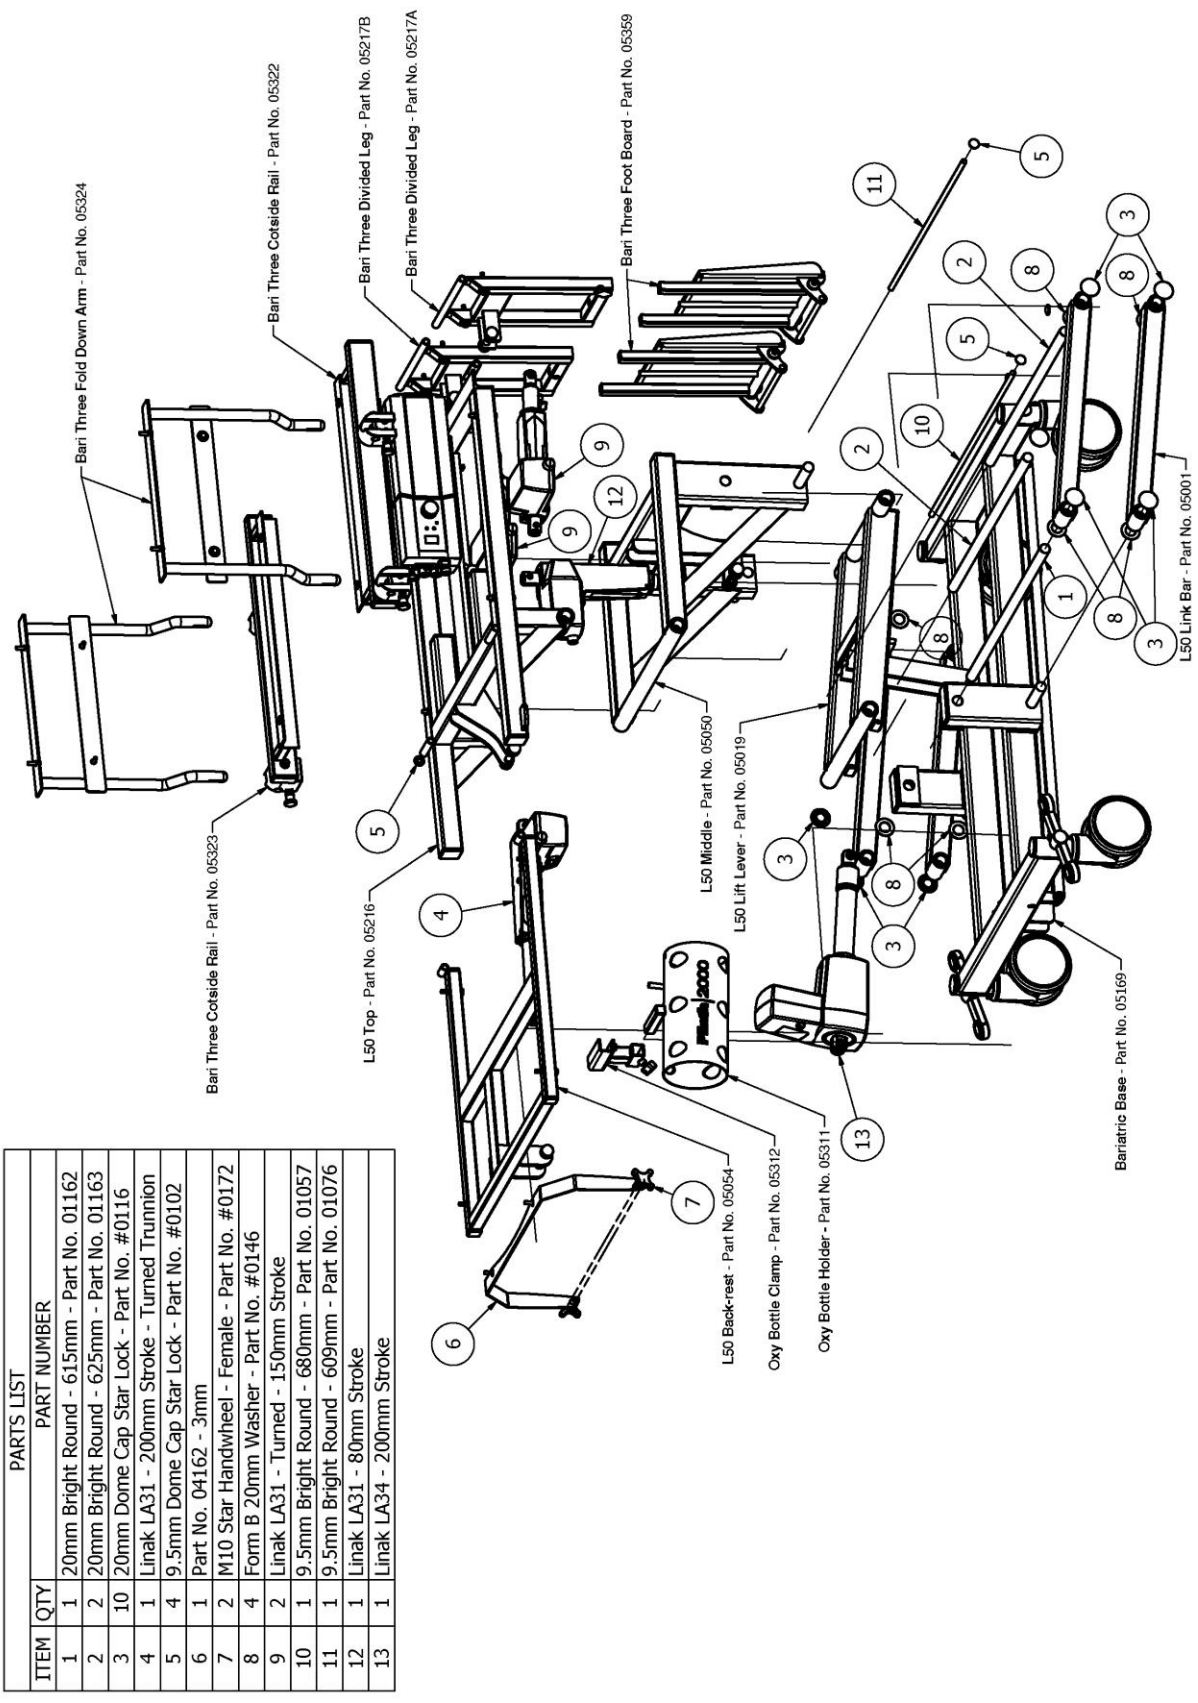

PARTS LIST		
ITEM	QTY	PART NUMBER
1	1	20mm Bright Round - 615mm - Part No. 01162
2	2	20mm Bright Round - 625mm - Part No. 01163
3	10	20mm Dome Cap Star Lock - Part No. #0116
4	1	Linak LA31 - 200mm Stroke - Turned Trunnion
5	4	9.5mm Dome Cap Star Lock - Part No. #0102
6	1	Part No. 04162 - 3mm
7	2	M10 Star Handwheel - Female - Part No. #0172
8	4	Form B 20mm Washer - Part No. #0146
9	2	Linak LA31 - Turned - 150mm Stroke
10	1	9.5mm Bright Round - 680mm - Part No. 01057
11	1	9.5mm Bright Round - 609mm - Part No. 01076
12	1	Linak LA31 - 80mm Stroke
13	1	Linak LA34 - 200mm Stroke

PARTS LIST		
ITEM	QTY	PART NUMBER
1	4	38 Tube Bung - Part No. #0121
2	2	80x40 RHS Cap Thin - With Cut Out - Part No. #0131
3	1	11mm Hex Bar @ 750mm - Part No. 01227
4	1	11mm Hex Bar @ 715mm - Part No. 01226
5	2	Part No. 04090 - 6mm
6	6	M12 Form B Washer - Part No. #0145
7	2	12mm Dome Cap Star Lock
8	8	M6X10mm - Part No. #0224
9	4	Steinco Hex Large Castor - Part No. #0264
10	1	Part No. 04238 - 8mm
11	1	Brake Lever - Part No. #0138A1
12	1	Brake Lever
13	2	Brake Lever Green Insert - Part No. #0245
14	2	Brake Lever Red Insert - Part No. #0244
15	2	M8 @ 35mm - Dome Head - Part No. #0250
16	2	M8 Cap - Part No. #0160

Bariatric Base - Part No. 05169

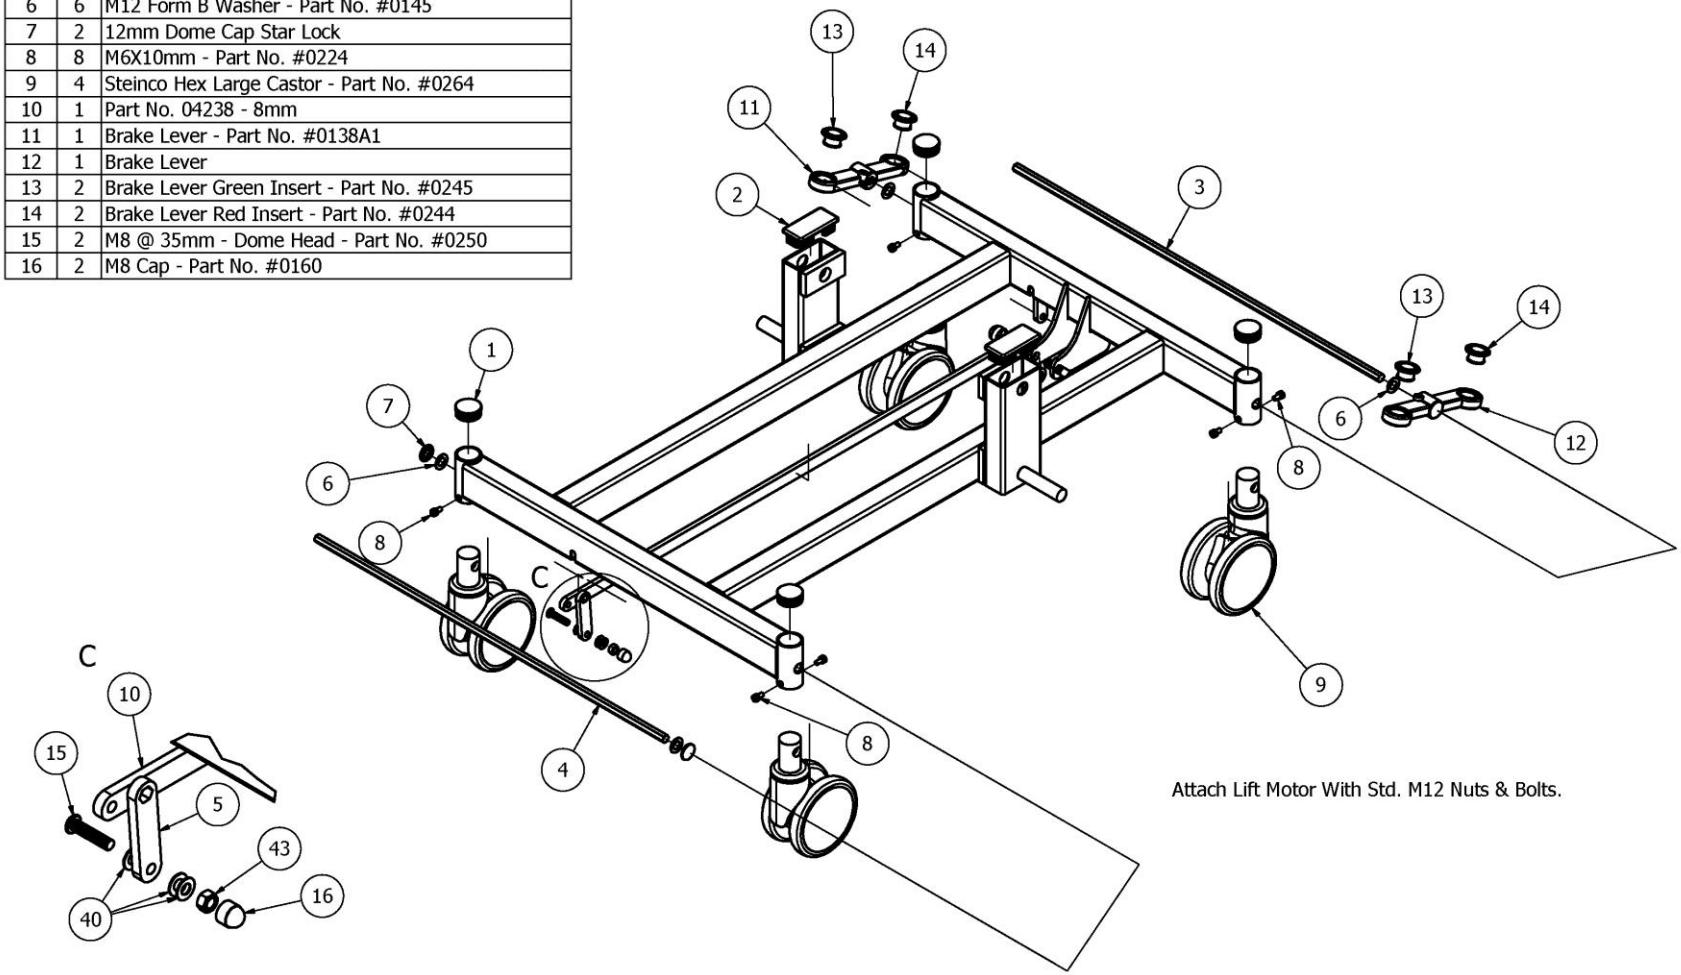

PARTS LIST		
ITEM	QTY	PART NUMBER
1	4	20mm Nylon Bush - Part No. #0182
2	4	40x20 Cap - Part No. #0122
3	1	M12 Form B Washer #0145 - M12 @ 75mm Bolt #0176 - M12 Dome Cap #0177
4	1	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177

L50 Lift Lever - Part No. 05019

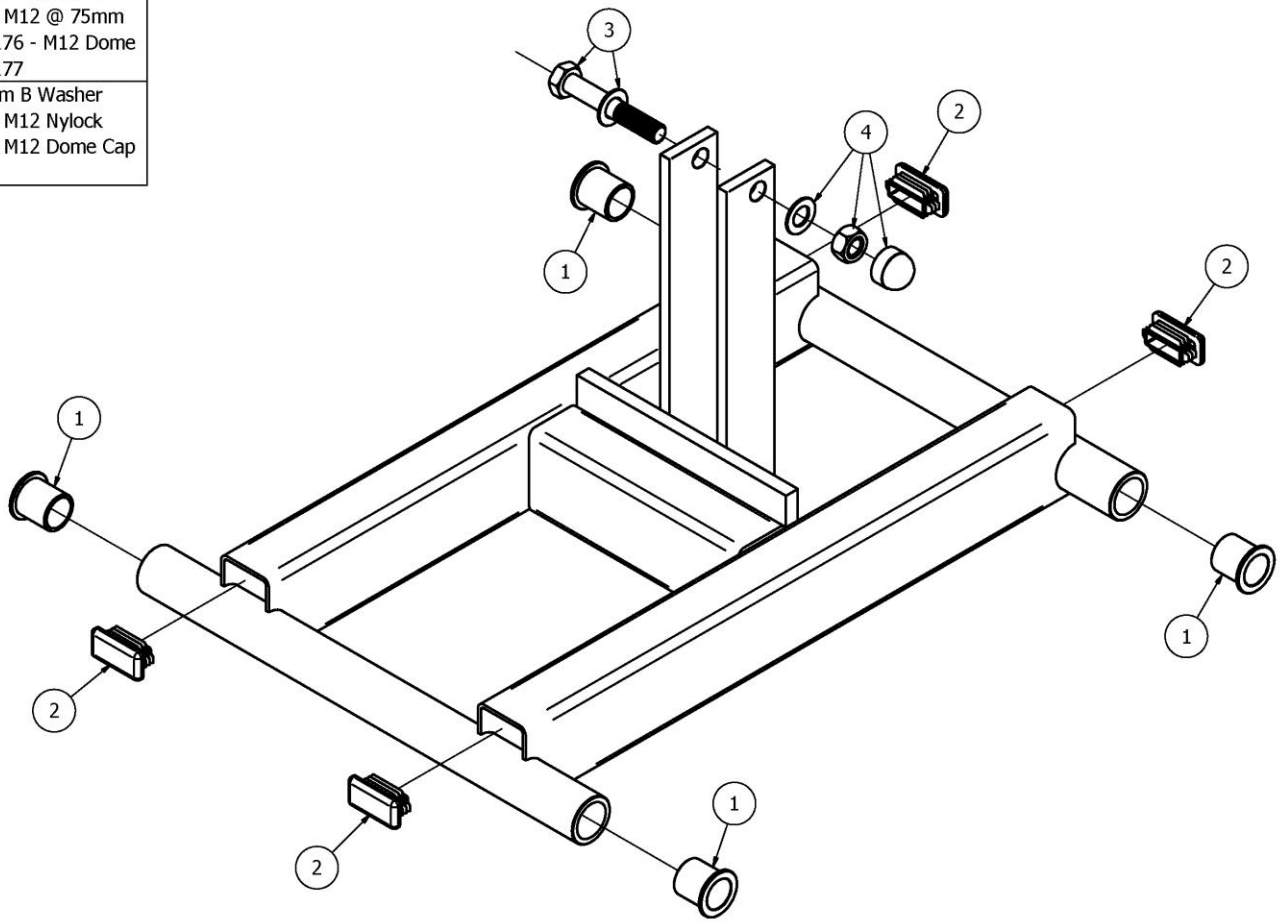

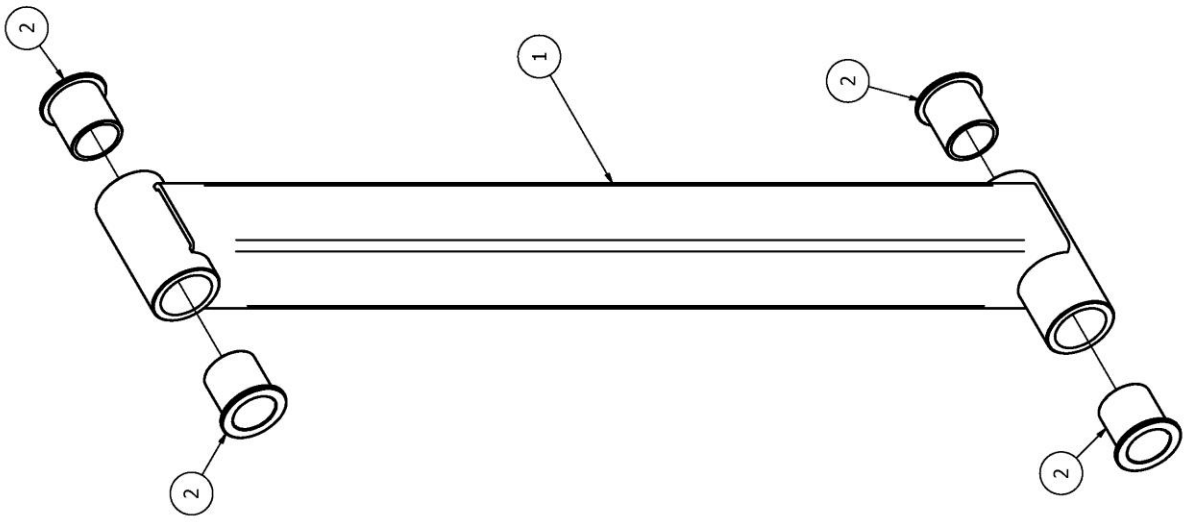

L50 Link Bar - Part No. 05001

PARTS LIST		
ITEM	QTY	PART NUMBER
1	1	Std. 60-80 Link Bar - Part No. 05002
2	4	20mm Nylon Bush - Part No. #0182

L50 Middle - Part No. 05050

PARTS LIST		
ITEM	QTY	PART NUMBER
1	2	40x40 Cap - Part No. #0123
2	2	20mm Nylon Bush - Part No. #0182
3	2	M12 Form B Washer #0145 - M12 @ 75mm Bolt #0176 - M12 Dome Cap #0177
4	2	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177
7	3	16x2 - Aluminium Tube - 8mm - Part No. 02180

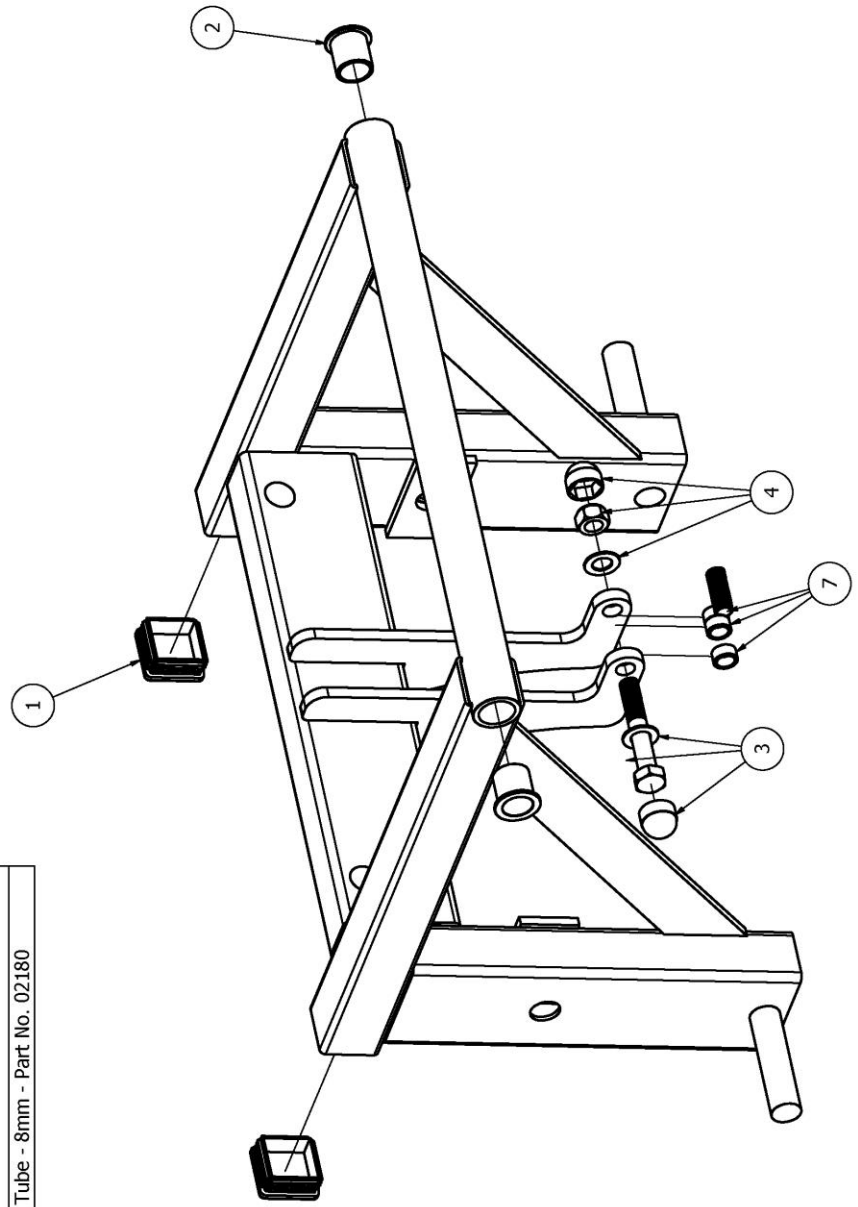

PARTS LIST		
ITEM	QTY	PART NUMBER
1	4	20mm Nylon Bush - Part No. #0182
2	1	M12 Form B Washer #0145 - M12 @ 75mm Bolt #0176 - M12 Dome Cap #0177
3	6	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177
4	3	M12 Form B Washer #0145 - M12 Bolt @ 60mm #0175 - M12 Dome Cap #0177
5	4	40x40 Cap - Part No. #0123
6	4	M6 @ 50mm #0155 & Repair Washer #0184
7	5	M12 Form B Washer - Part No. #0145
8	2	M12 Form B Washer #0145 - M12 Bolt @ 50mm #0200 - M12 Dome Cap #0177

L50 Top - Part No. 05216

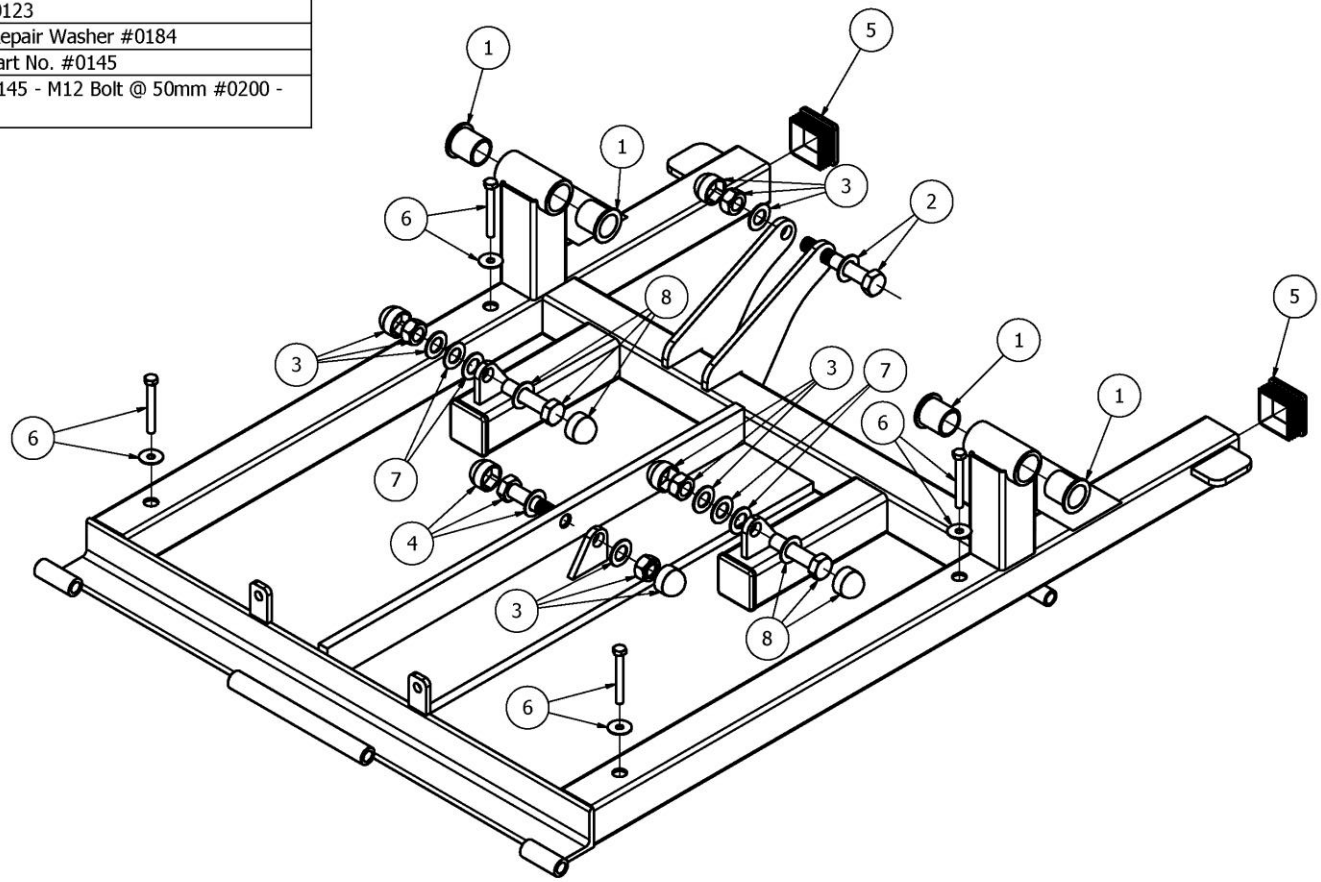

L50 Back-rest - Part No. 05054

PARTS LIST		
ITEM	QTY	PART NUMBER
1	2	25.4x25.4 Cap - Part No. #0112
2	4	M6 @ 40mm #0154 & Repair Washer #0184
3	1	M12 Form B Washer #0145 - M12 @ 75mm Bolt #0176 - M12 Dome Cap #0177
4	1	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177
5	1	Part No. 05085 - M50 SLARM
6	3	16x2 - Aluminium Tube - 8mm - Part No. 02180
7	1	Part No. 05311 - Oxy Bottle Holder
8	1	Part No. 05312 - Oxy Bottle Clamp

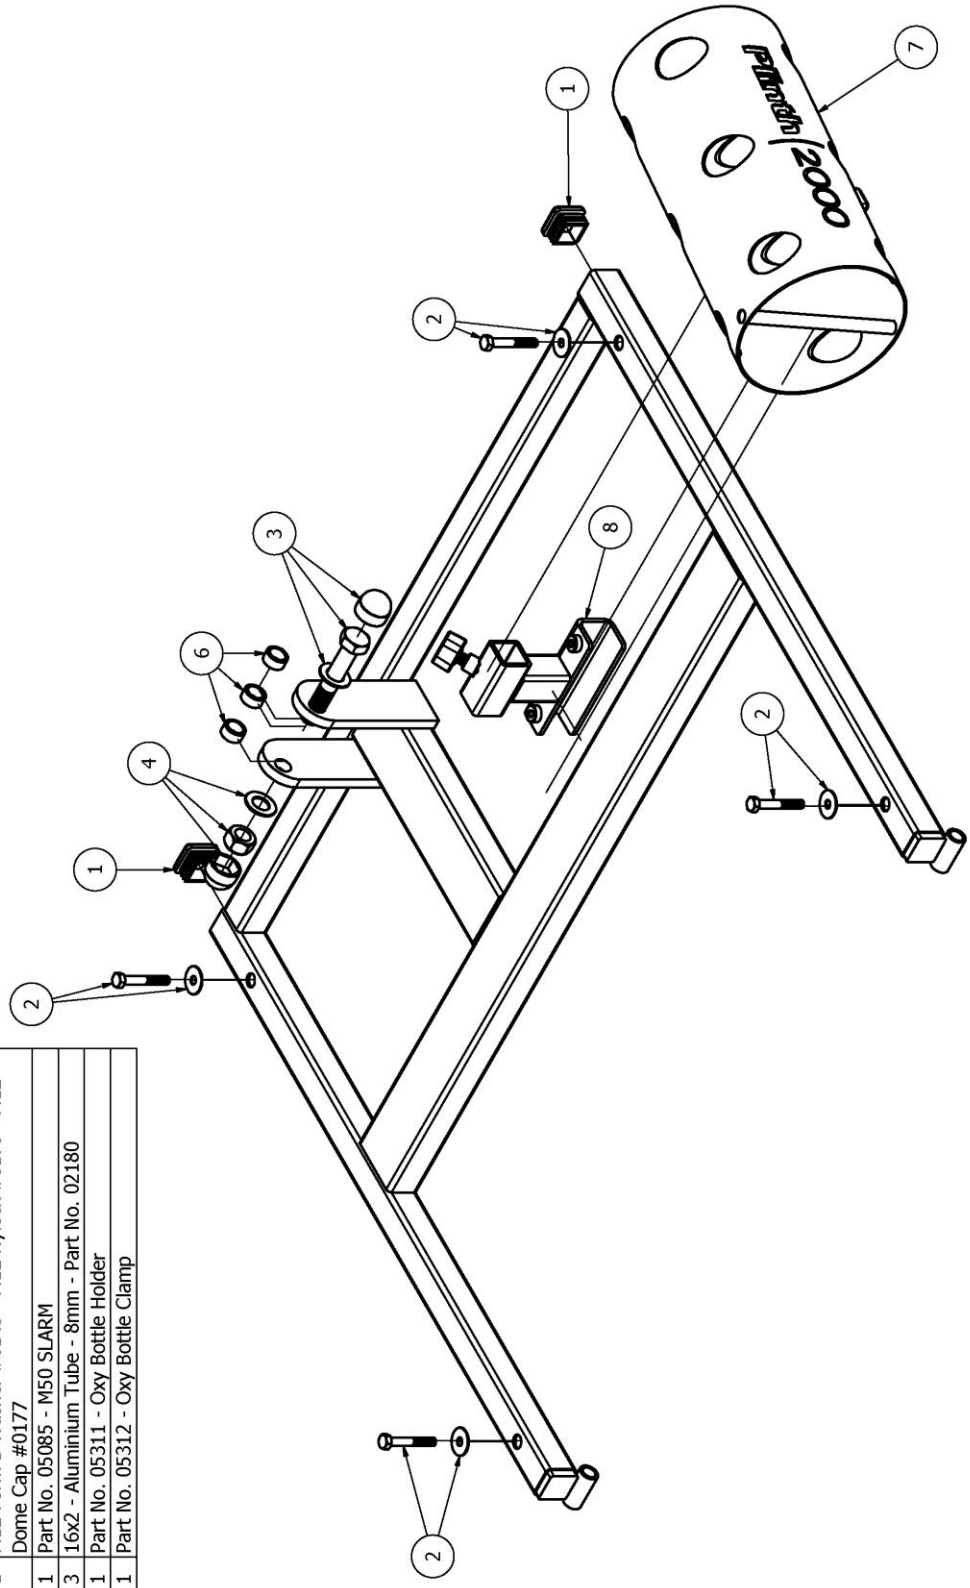

Bari Three Divided Leg - Part No. 05217A

PARTS LIST		
ITEM	QTY	PART NUMBER
1	1	M8 Thumb Screw - Part No. #0163
2	2	M6 @ 40mm #0154 & Repair Washer #0184
3	3	M12 Form B Washer #0145 - M12 Bolt @ 60mm #0175 - M12 Dome Cap #0177
4	3	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177

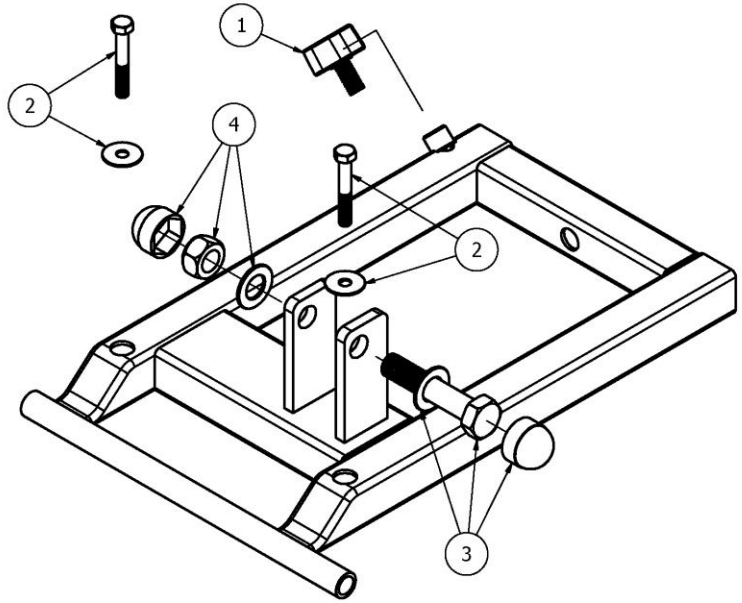

Bari Three Divided Leg - Part No. 05217B

PARTS LIST		
ITEM	QTY	PART NUMBER
1	3	M6 @ 40mm #0154 & Repair Washer #0184
2	1	M8 Thumb Screw - Part No. #0163
3	1	M12 Form B Washer #0145 - M12 Bolt @ 60mm #0175 - M12 Dome Cap #0177
4	1	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177

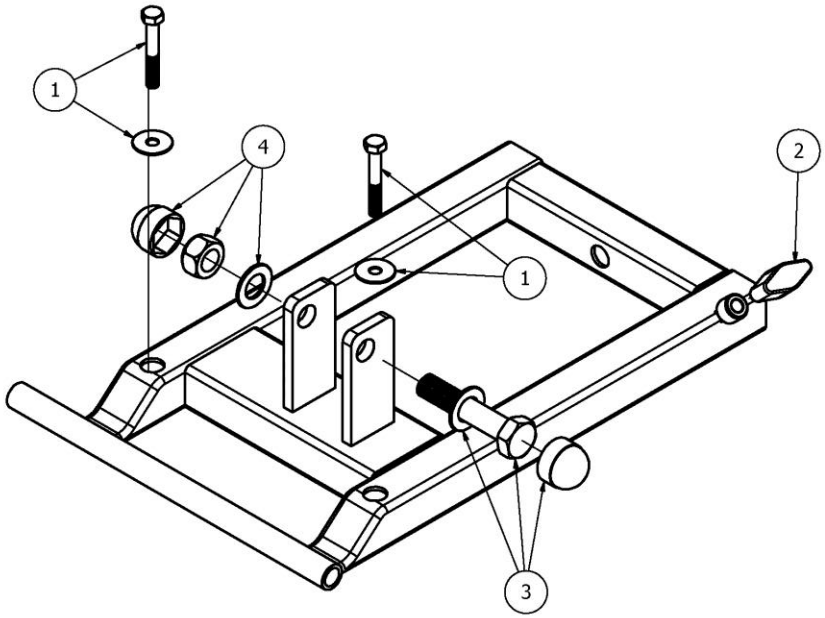

Bari Three Foot Board - Part No. 05359

PARTS LIST		
ITEM	QTY	PART NUMBER
1	6	M12 Form B Washer - Part No. #0145
2	2	Nylon Washer
3	1	M12x60 Dome Head - Part No. #0234
4	1	M12 Form B Washer #0145 - M12 Nylock #0178 - M12 Dome Cap #0177

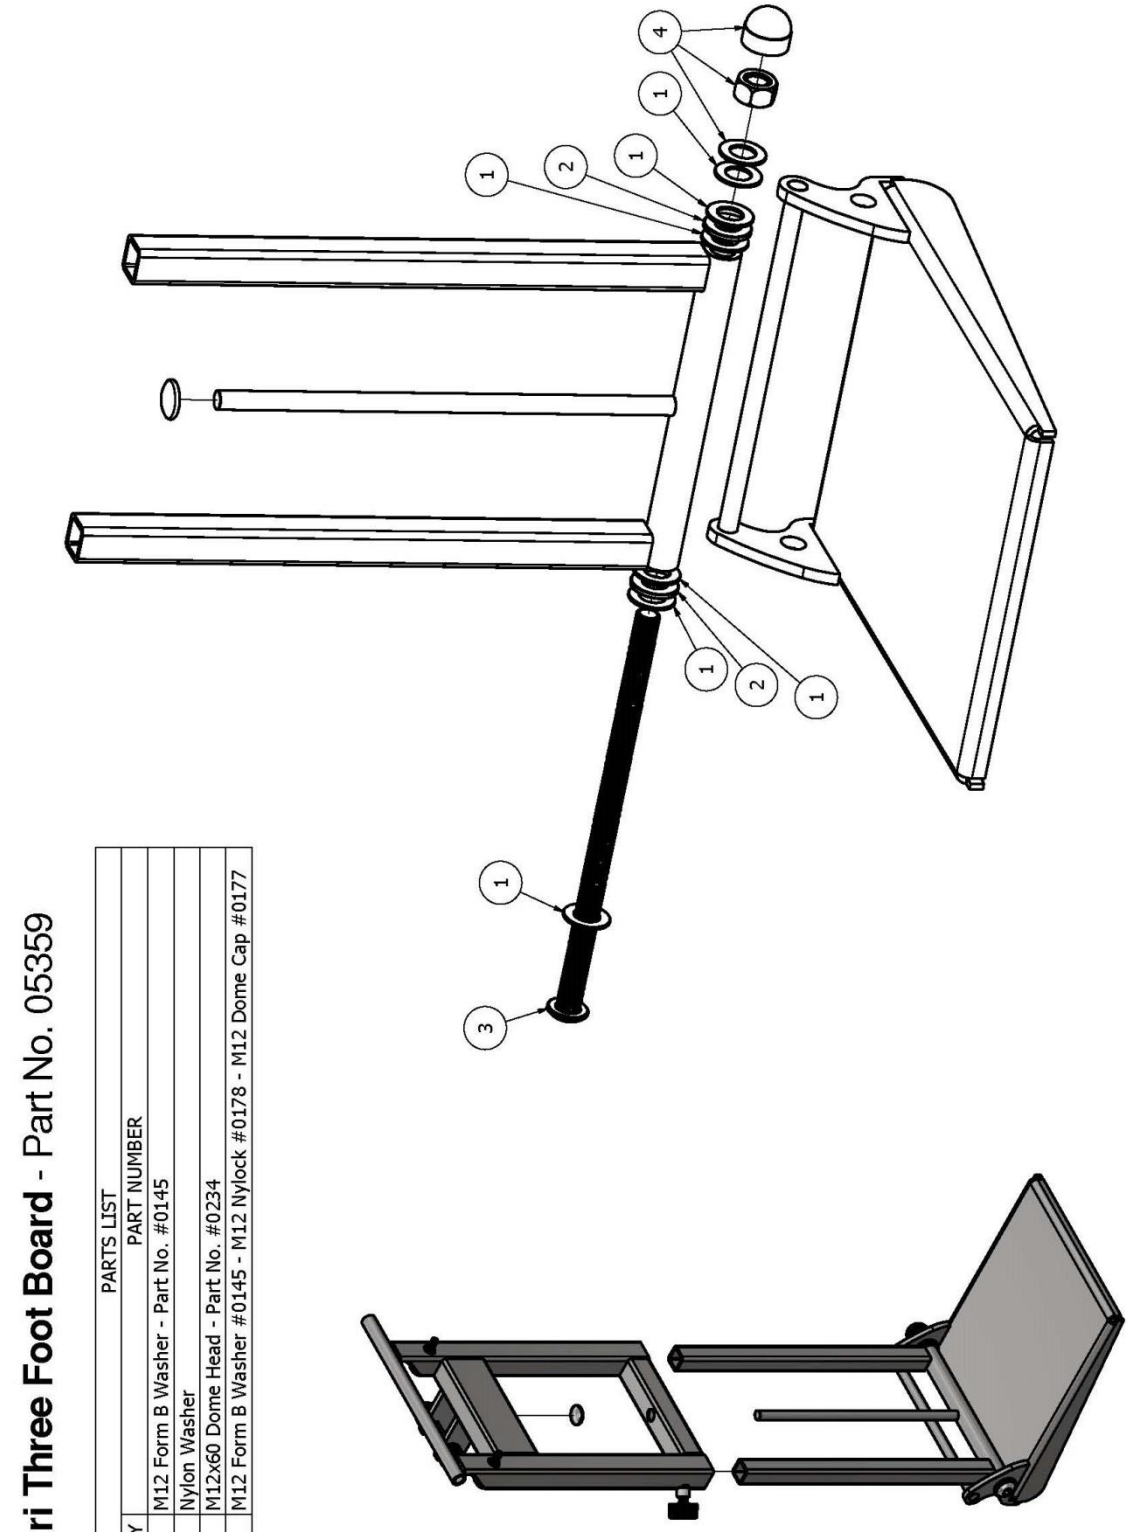

Bari Three Cotside Rail - Part No. 05322

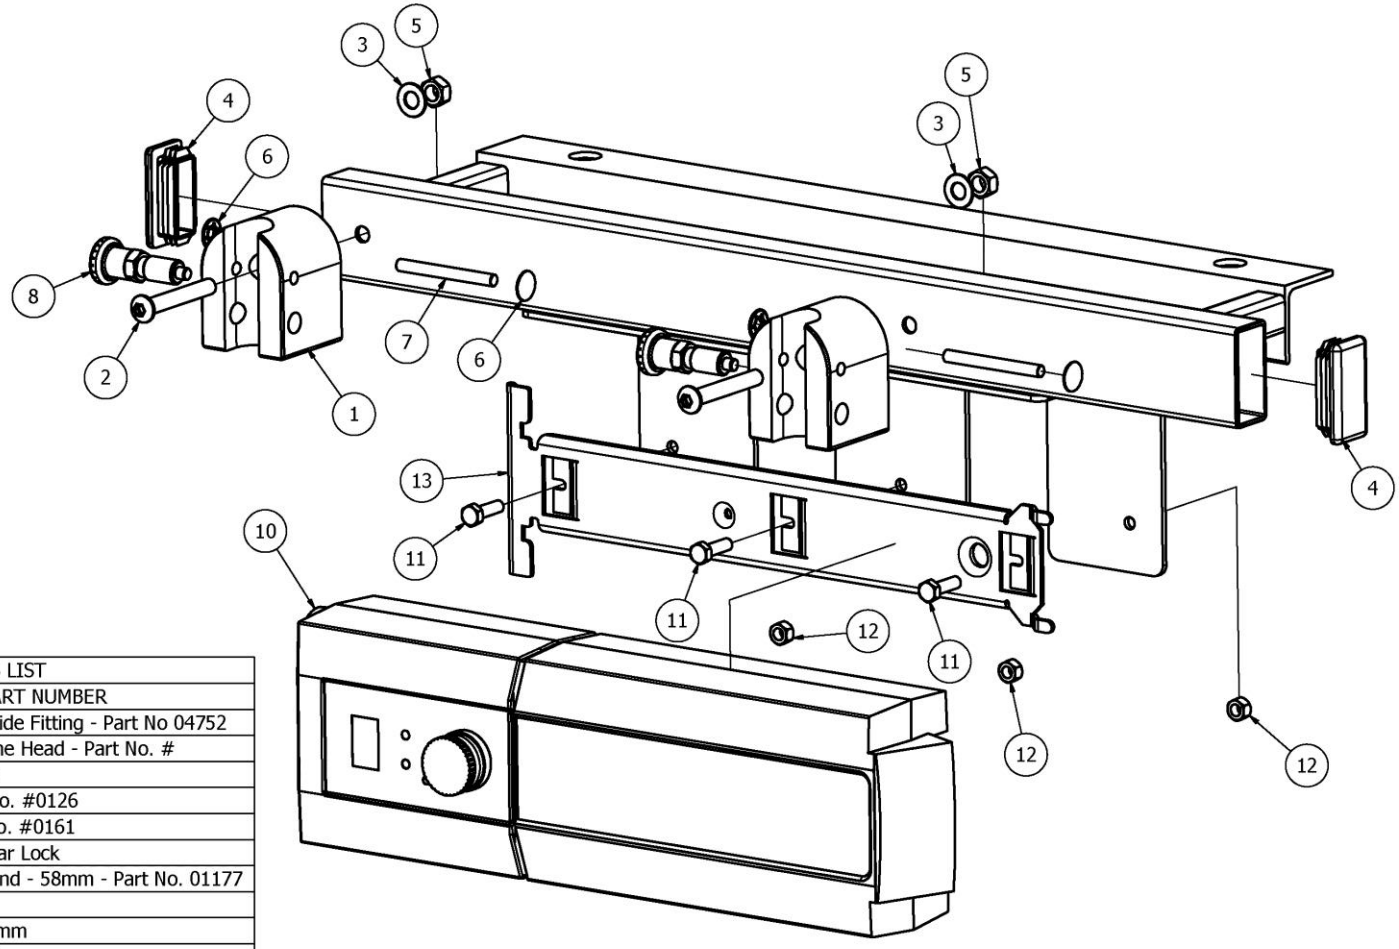

PARTS LIST		
ITEM	QTY	PART NUMBER
1	2	Index Plunger Cotside Fitting - Part No 04752
2	2	M8 @ 55mm - Dome Head - Part No. #
3	2	Form B M8 Washer
4	2	50x25 Cap - Part No. #0126
5	2	M8 Nylock - Part No. #0161
6	4	6mm Dome Cap Star Lock
7	2	6mm Stainless Round - 58mm - Part No. 01177
8	2	EH 22110.0109
9	1	Part No. 04189 - 3mm
10	1	Jumbo Battery Pack
11	3	M6 @ 20mm
12	3	M6 Nylock - Part No. #0156
13	1	Part No. 04094 - 2mm

Opposing Cotside Rail (Part No. 05323) Identical Fittings, Except Jumbo Pack & Rear Jumbo Fitting Mount.

Bari Three Fold Down Arm - Part No. 05324

PARTS LIST		
ITEM	QTY	PART NUMBER
5	4	M6 @ 20mm #0153 & Repair Washer #0184

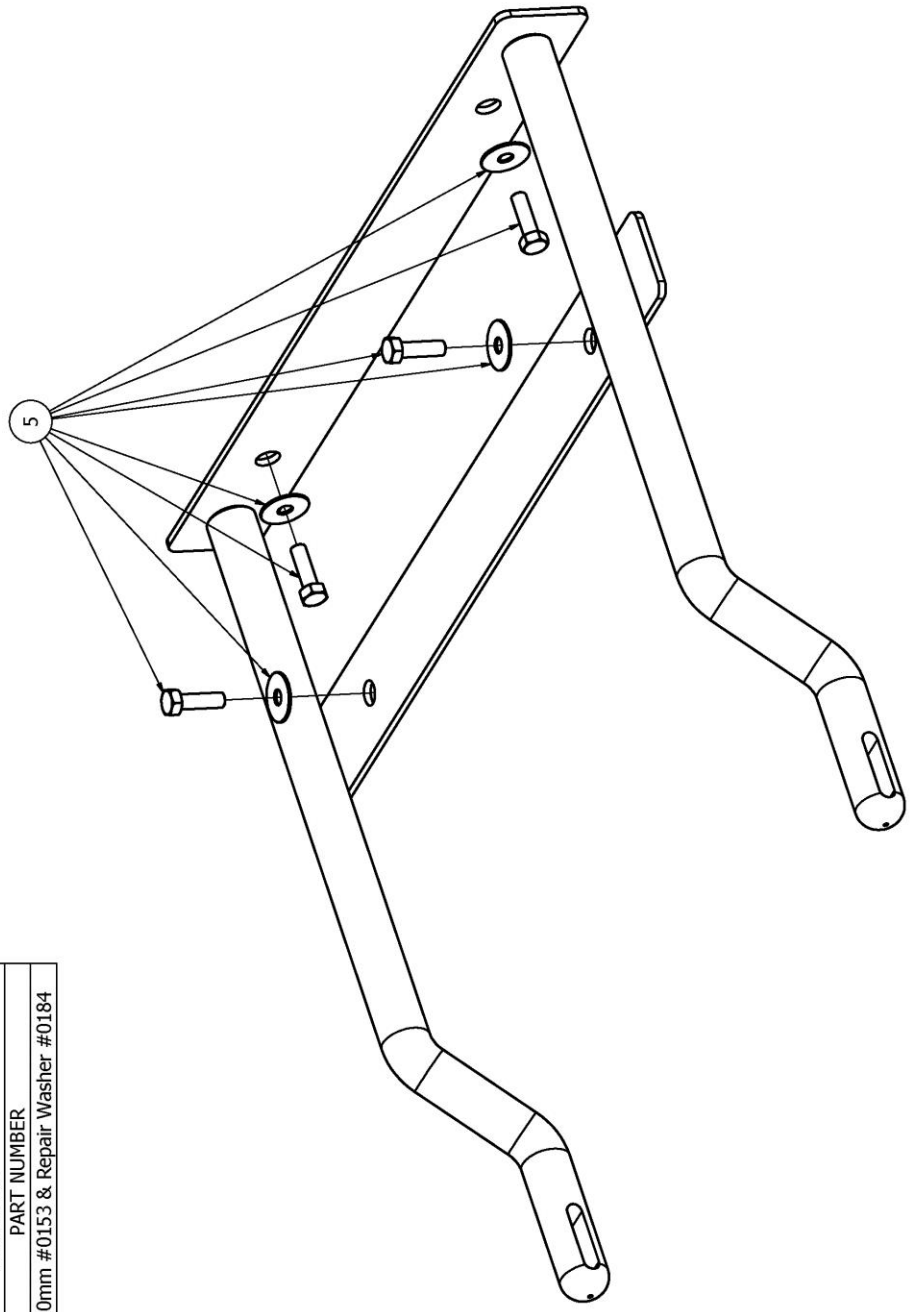

6. Guarantee and Service (UK only)

Plinth 2000 Ltd offer a 5 year parts guarantee on all Premium Range products delivered from January 2013 and a lifetime frame guarantee. The only exclusion to this guarantee is for negligent damage or damage to upholstery coverings. This guarantee does not require registration of the product as we can trace it from its serial number, however in the event of the serial number being removed, missing or unreadable then this may void the guarantee. These terms do not affect your statutory rights.

In addition to the above Plinth 2000 Ltd can offer both extended warranties and service contracts. For further information about either of these please contact:

Customer Service
Plinth 2000 Ltd
Wetheringsett Manor
Wetheringsett
Stowmarket
Suffolk
IP14 5PP
Tel: 01449 767887
Mail: customerservice@plinth2000.com

In the event of returning a product or part to us then please follow the instructions for cleaning under section 5 before enclosing it in suitable packaging and returning it to the above address. In addition please ensure there is a statement confirming that it has been decontaminated and what the fault is along with relevant contact details.

Worldwide

Please contact the distributor you purchased the trolley from for service and support in your country. If you are unable to do so then please contact us in the UK and we will refer you to our local representative.

7. Technical Specifications

	BARI3			
Head Length (cm)	**78**			
Seat Length (cm)	**56**			
Foot Length (cm)	**48**			
Width (cm)	**78**			
Overall Length (cm)	**168**			
Height Range (cm)	**56-104**			
Max Working Load	**320kg**			
Control	**Hand switch**			
Motor(s)	**Linak LA34 x 1** **Linak LA31 x 1**			
Control Box	**Linak JUMBO**			
Current	**1.5A**			
Power	**360W**			
Mains Plug Fuse	**5.0A x 1**			
Internal Fuse	**3.0A x 1**			
System Voltage	**24v**			
IP Rating	**IPX4**			
Battery Capacity	**1.2AH (24v)**			
Motor(s)	**Linak LA34 x1** **Linak LA31 x 1**			
Control Box	**Linak JUMBO**			
Current	**2.7A**			
Power	**360W**			
Mains Plug Fuse	**5.0A x 1**			
Internal Fuse	**3.0A x 1**			
System Voltage	**24v**			
IP Rating	**IPX4**			
Battery Capacity	**1.2AH (24v)**			

IEC 601-1 Electrical Safety Classification

All models are double insulated Type B equipment and marked as such.

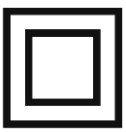

Double Insulated

Type B Equipment

8. Revisions to Manual

Pages	Issue No	Name	Date
All	Manual - 01	Niall Dyer	18.12.14

Plinth 2000 Ltd
Wetheringsett Manor
Wetheringsett
Stowmarket
Suffolk
IP14 5PP
ENGLAND

Plinth 2000 Ltd is an ISO Audited company to ISO9001:2008

Our products are CE marked in conformity with the EC Directive MDD 93/42/EEC